

# **Functionality Assessment of Household Tap Connection under National Jal Jeevan Mission - 2022**



District Report:Nilgiris, Tamil Nadu Survey Duration: March to April 2022

### Contents

Abl	orev	riations	3
Glo	ssa	ıry	4
1.	Fa	actsheet	6
2.	С	ontext	8
2.1		District snapshot:	8
2.2		FHTC Assessment Objectives	9
2.3		Assessment Methodology	9
2.4		Sample Size	9
2.5		Sampling Methodology	10
2.6		Methodology for Water Quantity Measurement at Households	11
2.7		Methodology for Water Quality Measurement	11
2.8		Project implementation	12
2.9		Sample coverage	13
2.1	0.	Sampled village and household profile	13
3.	Fi	ndings	14
3.1		Functionality status of FHTC at household level	14
3.2		Quantity, Regularity, and Quality of Water	15
3.3		Average water supply days in a week	18
3.4		Household utilization of water for drinking and other activities	18
3.5		Status at HH level (Nh=)	18
3.6		Source sustainability at the village level	19
3.7		Water quality monitoring and surveillance in the villages	20
3.8		Status of JJM	20
3.9		Perception of HHs on Outcome Indicators	21
3.1	0.	User satisfaction	22
4.	A	nnexures	23
4	l.1.	Summary of villages	23
4	l.2.	Functionality – 55 LPCD vs regularity vs potability vs working tap connection	23
4	l.3.	Villages not meeting the quality parameters	24

# **Abbreviations**

AWC	Aanganwadi Centre
FHTC	Functional Household Tap Connection
Gol	Government of India
GP	Gram Panchayat
HF	Health Facility
HH	Household
HGJ	Har Ghar Jal
JJM	Jal Jeevan Mission
LPCD	Litres per Capita per Day
MVS	Multi-village Scheme
NJJM	National Jal Jeevan Mission
RC	Residual Chlorine
O&M	Operation and Maintenance
OHT	Over Head Tank
PSU	Primary Sampling Unit
PWS	Piped Water Supply
SVS	Single Village Scheme
VAP	Village Action Plan
VWSC	Village Water and Sanitation Committee
WQMIS	Water Quality Monitoring and Information System

#### Glossary

- 1. **Community** Group of people living in one particular area or village/habitation
- 2. **Cross-sectional research** A cross-sectional study is a type of research design in which data is collected from a relatively large and diverse group of people at a single point in time
- 3. **Drinking water source** Groundwater (open well, borewell, tube well, handpump, spring, etc.)/ surface water (river, lake, pond, reservoir, etc.)/rainwater, available for drinking and domestic use
- 4. Improved sources The following sources as considered improved by the National Family Health Survey definitions: Piped water into dwelling, yard/plot with a tap, piped water connected to public stand-posts, tube well or borewell, Hand pump, dug well– protected, Spring–protected, Rainwater, Water ATM/ Community RO plant/ Community Water Purification Plant (CWPP)
- 5. **Unimproved sources** The following sources as considered unimproved by the National Family Health Survey definitions: Unprotected spring, unprotected dug well, cart with small tank / drum, Tanker/ truck, Surface water (river/ dam/ lake/ pond/ canal), and bottled water
- 6. **Functional Household Tap Connection (FHTC)** A tap connection to a rural household for providing drinking water in adequate quantity of prescribed quality on regular basis.
- 7. **Functionality of FHTC** Functionality of a tap connection is defined as having infrastructure, i.e., household tap connection providing water in adequate quantity, as presented:

Definitions	Fully-functional	Partially-functional	Non-functional
Quantity	>= 55 LPCD	> 40 LPCD - < 55 LPCD	< 40 LPCD
Regularity	12 months or daily basis	9-12 months or < daily basis	< 9 months or < daily basis
Quality	Potable	Potable	Non potable

- 8. **Quantity (in litres)** of water received by households per person per day should meet the service level of 55 LPCD
- 9. **Functionality Assessment** An assessment of the functionality of rural household tap connections based on a sample survey
- 10. **Fully Regular –** Regularity of water is considered when a rural household receives water for 12 months on daily basis or as per schedule.
- 11. **Potability** Potable water is water that is safe to be used as drinking water. Parameters of potable water are mentioned below:

Parameters for potable water		l lm:4	A coontable I imit	Permissible Limit in
	d in the survey	Unit	Acceptable Limit	the absence of
				alternative sources
i.	pH (tested on site)	-	6.5 to 8.5	No relaxation
ii.	Free residual chlorine (tested on site)	Mg/litre	0.2	1
iii.	Turbidity	NTU	1	5
iv.	Total hardness	Mg/litre	200	600
V.	Total alkalinity	Mg/litre	200	600
vi.	Chloride	Mg/litre	250	1000
vii.	Ammonia	Mg/litre	0.5	No relaxation
viii.	Phosphate	Mg/litre	0.3	1
ix.	Iron (in hotspots only)	Mg/litre	1	No relaxation
X.	Nitrate	Mg/litre	45	No relaxation
xi.	Sulphate	Mg/litre	200	400
xii.	Total dissolved solids	Mg/litre	500	2000

Parameters for potable water tested in the survey		Unit	Acceptable Limit	Permissible Limit in the absence of alternative sources
xiii.	Fluoride	Mg/litre	1	1.5
xiv.	Arsenic (in hotspots only)	Mg/litre	0.01	No relaxation
xv. Bacteriological test for Total coliform bacteria and E. coli or thermotolerant coliform bacteria			Shall not be detectable in	n any 100 ml sample

- 12. **Sampling** Selection of a subset of individuals from within a statistical population to estimate water service delivery among the population. In the current study, households have been sampled to estimate the representation of the village and subsequently of the district as well as of the state.
- 13. Types of schemes: Following are the piped water supply schemes that were assessed
  - a. Mini-solar based piped water supply scheme in isolated/tribal hamlets
  - b. Single Village Scheme (SVS) in villages having adequate groundwater that needs treatment
  - c. Single village scheme (having adequate groundwater/ spring water/ local or surface water source of prescribed Quality)
  - Retrofitting of ongoing schemes taken up under erstwhile NRDWP for the last mile connectivity/ retrofitting of completed rural water supply schemes to make it JJM compliant
  - e. Multi-village PWS scheme with water grids/ regional water supply schemes
- 14. Village Action Plan (VAP) Plan prepared by Gram Panchayat and/ or its sub-committee, i.e., VWSC/ Paani Samiti/ User Group, etc. based on baseline survey, resource mapping and felt needs of the village community to provide FHTC to every rural household, treat the generated greywater and plan its reuse, undertake surveillance activities, etc. VAP also indicates the fund requirement and timelines for completion of work under the Mission and will be approved by the Gram Sabha. Irrespective of the source of funding, all drinking water-related works in the village are taken up based on the VAP.
- 15. **Source Sustainability** includes measures such as aquifer recharge, rainwater harvesting, increased storage capacity of water bodies, reservoirs, de-silting, etc. improve the lifespan of water supply systems
- 16. **Har Ghar Jal (HGJ)** An administrative unit wherein all HHs are provided with water supply through FHTCs is called "Har Ghar Jal".
- 17. **Public Institutions** The public institutions in the survey include Aanganwadi Centre (AWC), Health Facilities, Schools, Gram Panchayat, and government buildings.
- 18. **Working tap connection –** A tap connection supplied water at least one day in the week, preceding of survey
- 19. **Functional Scheme –** A scheme is said to be functional if it was reported to be working for all 12 months in a year.

# 1. Factsheet

Indicators	State	District
Functionality status of FHTC at households		
Households (HHs) which received water through FHTC at least once in last 7 days (%)	100	91
Fully functional (%)	86	95
Partially functional (%)	11	3
Non-functional (%)	3	2
Quantity of water received by households		
Adequate quantity (>55 LPCD) (%)	98	97
Partially adequate quantity (> 40 LPCD - < 55 LPCD) (%)	3	2
Inadequate quantity (<40 LPCD) (%)	3	2
Regularity of water received by households		
Fully Regular Supply (as per schedule) (%)	93	99
Partially Regular Supply (not as per schedule) (%)	5	1
Irregular Supply (less than 9 months' supply) (%)	2	0
Potable (Quality) water received by households		
Potable (%)	97	100
Non-potable (%)	3	0
Residual Chlorine (RCL) detected with in permissible limits (%)	32	2
Household level indicators		
Households receiving water supply daily-7 days a week (%)	74	60
Daily HH requirement of water being met by FHTC (%)	95	94
Households reported FHTC as a primary source of drinking water (%)	84	36
Households purifying water before drinking (%)	52	83
Households paying water service delivery charges (%)	53	10
Households having coping mechanisms during scarcity (%)	36	22
Households aware of grievance redressal mechanism for reporting problems with FHTC (%)	93	100
Households reported incidence of water-borne diseases in the last year (%)	0	0
Households reported a reduction in time and effort in collecting water (%)	78	74
Overall user satisfaction at the household level		
Regularity (%)	95	93
Overall quality (%)	91	92

Indicators	State	District
Village level indicators (based on village questionnaire)		
Schemes reported to be functional (%)	40	25
Villages with groundwater resource (%)	65	82
Villages having groundwater recharge structure <sup>1</sup> (%)	13	0
Water supply and storage status in villages		
Average no. of times water is supplied in a day	1	2
Villages having OHT/ Sump for storage of water (%)	98	100
Water quality monitoring and surveillance in the villages		
Villages with Field Test Kits (%)	73	100
Villages in which bacteriological test was done in last 1 year by VWSC/ Pani Samiti (%)	31	18
Villages reported to have a mechanism for chlorination (%)	72	100
VWSC/Pani Samiti and PWS signage in villages		
Village reported having presence of VWSC/ Pani Samiti (%)	41	100
Villages in which VWSC/ Pani Samiti is responsible for Operation & Maintenance of PWS schemes (%)	13	0
Villages in which persons are trained to use Field Test Kits (%)	62	100
Villages in which signages about JJM were observed (%)	11	9
Operation and maintenance at village		
Villages levying water service delivery to households (%)	63	9
Convergence of JJM activities with other schemes in the villages (%)	8	0
Villages having skilled manpower for Operation & Maintenance of PWS schemes (%)	48	73
Community monitoring of water wastage in villages (%)	32	36


7

 $<sup>^{\</sup>rm 1}$  Out of villages who reported to have groundwater source (Nv=9)

#### 2. Context

Jal Jeevan Mission (JJM) was launched on the 15th of August 2019 with the objective to provide functional household tap connections (FHTCs) to all rural households.

Figure 1: Har Ghar Jal - Objective, Vision, & Outcome

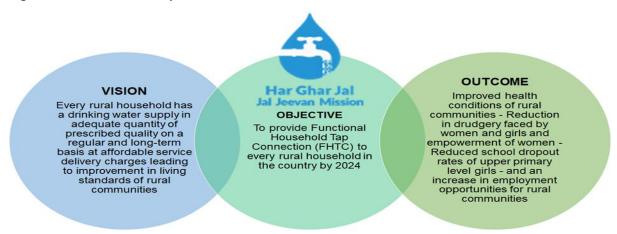

In accordance with the overall objectives as specified in the Operational Guidelines for the implementation of the NJJM, GoI carried out a sample survey to assess the functionality of household tap connections. As part of this endeavour, NJJM, GoI engaged HTA Kantar Public to conduct the 'Functionality Assessment' of the household as well as public institution/buildings such as schools, anganwadis, gram panchayat buildings, public health facilities, and wellness centers in all the rural districts for the fiscal year 2021-22.

#### 2.1. District snapshot: Nilgiris

District Nilgiris of Tamil Nadu has a population of 336780. The district has 4 blocks. Out of 35 villages in the district, 12 are SC dominated and 3 are ST dominated villages. The district lies in Southern Plateau And Hills Region and receives an annual rainfall of 1567.1mm.

Presented here are district level information collated from the DDWS-IMIS:

Figure 2: District IMIS Status & Map

#### IMIS status:

- 0 (0% of all) villages are Har Ghar Jal
- 35 (100% of all) villages are Non-Har ghar Jal
- SC/ST dominated district
- Non JE/AES
- Yes- History of water contamination
- 33 (94% of all) villages with PWS more than 20 FHTC



#### 2.2. FHTC Assessment Objectives

Figure 3: Objectives of Functionality of Tap Connections



#### 2.3. Assessment Methodology

A cross-section research design has been used for this functionality assessment study. Quantitative data were collected from villages and households across all states/UTs using the CAPI (Computer Assisted Personal Interviewing) mode. The survey includes two components, village, and household.

Figure 4: Survey Components & Respondents



#### 2.4. Sample Size

The sample size was calculated to provide estimates with a 95% confidence interval (CI) and 5% margin of error (MoE) after incorporating the correction factor for a finite population considering the total number of geographic units having FHTCs.

- Village sample is estimated to be representative at the state level
- HH sample estimated to be representative at the district level

- Number of Har Ghar Jal (HGJ) villages were proportionately sampled at the district level
- All PWS schemes (up to 4) were covered per village. Per scheme approximately 9 (3 each from the head, middle, and tail HHs) or 18 households (6 each from head, middle, and tail HHs) were sampled to achieve the desired sample at the district level.


#### 2.5. Sampling Methodology

As per the design, all villages having a PWS scheme with 20 or more functional household tap connections were included in the sample frame. The probability proportionate to size (PPS) method was used for village selection in each district. The steps for random selection of villages using PPS are as presented:

Figure 5: Steps for Village Sampling




The key considerations for the village and household sampling were:

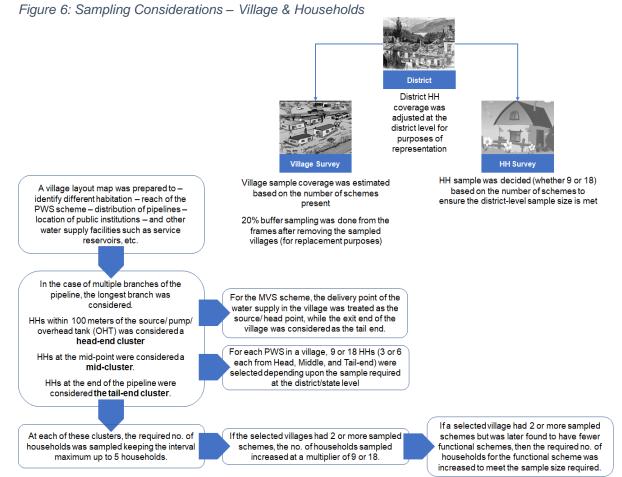

The record of all district-wise village replacements is maintained and reported as part of the annexure.

#### 2.6. Methodology for Water Quantity Measurement at Households

Figure 7: Steps for Measuring Flowrate from Supply-tap at HHs

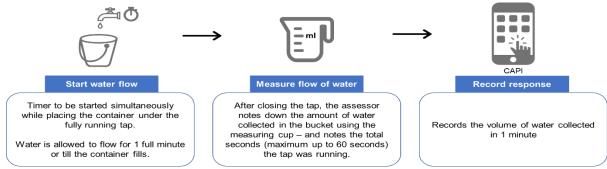

The flow rate of the water supply was measured using a container with gradual markings (either 5 litres or 1 litre, based on the flow of the tap) and a stopwatch/timer-watch. The process followed is as described in Figure 7.

In the case of households where the FHTC is connected directly with the storage tank, the following steps were adopted to measure the quantity:


- Assessor first asked and recorded length, breadth, and height.
- Assessor dipped a 5 feet long rod, marked the level of the water table, and calculated the volume – length x breadth x-height of water.
- Next the assessor opened the valve of the connection and allowed the water to flow inside the storage for 10 minutes.
- After 10 mins, the valve was closed, and the assessor again dipped the rod and recorded the new height of the water inside the tank. Based on this new 'height' and the CAPI calculated the changed volume.
- The difference in the volume of water in 10 minutes divided by 10 provided the flow rate of the water supply per minute.

The water flow rate was not measured for village-level public institutions.

#### 2.7. Methodology for Water Quality Measurement

Water quality was tested for all public institutions available in the villages, including schools, anganwadis, gram panchayat buildings, public health facilities, and wellness centers, and at the selected households. Two types of quality tests were carried out – a) spot test for pH and free residual chlorine, and b) water sample was collected and transported to labs for testing against 13 quality parameters (total 15) as specified in Figure 8.


Figure 8: On-site & Laboratory Based Quality Test

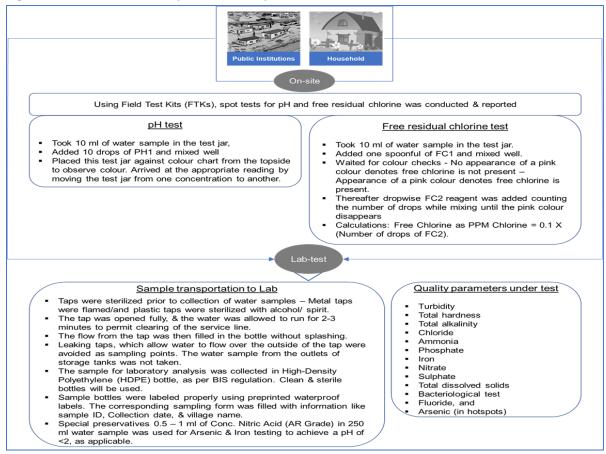

JJM, with the support of the BMI Division of ICMR, enabled a new interface on the WQMIS portal for "Functionality Assessment (FA) User" to enable seamless harmonization of water sample registration, sample submission for testing, and sharing of results as per the applicable quality parameters.

#### 2.8. Project implementation

An overview of the project implementation is as presented:

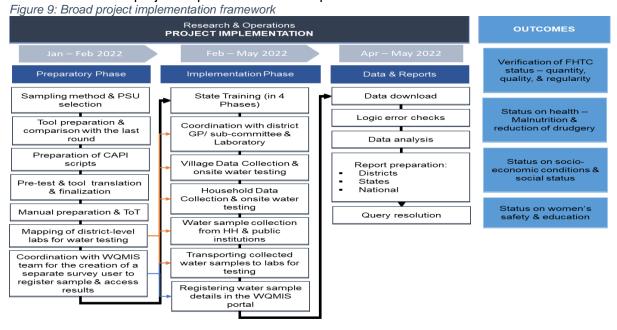

A total of 6 teams (comprising 6 supervisors, 72 assessors, and 6 water collection assistants) were recruited, trained, and deployed to complete the survey across the states of Tamil Nadu. One survey team covered approximately 2 – 3 districts. The state-wise team deployment and fieldwork dates were as presented:

Table No. 1: State-wise team deployment and data collection start & end dates						
State		Teams deployed	Start date	End date	Total data collection days	
Tamil Nadu		6 Teams	3/9/2022	4/7/2022	30 days	

A four-tier quality control (QC) system was put in place. At the ground level, the data collection exercise was done using a computer-aided Personal Interview (CAPI) application which contained all logic and skip-checks inbuilt. Also, 5% of the total samples were accompanied by the supervisors. Sub-targeted QC was done by the state field managers (5%) and the central project management team (5%). Apart from this, the central research team monitored the data trend and as per requirement debriefed data collection teams to improve quality.

#### 2.9. Sample coverage

Table No. 2:	Sa	mple covered				
		Targeted	d sample		Achieved sam	ple
District		Village	НН	Village	НН	Public Institutions
Nilgiris		11	396	11	396	27
Tamil Nadu		413	13,887	413	13,922	987

#### 2.10. Sampled village and household profile


#### **SAMPLED VILLAGES** SAMPLED HOUSEHOLDS Total no. of villages covered in the district - 11 Total no. of households covered in the district Percentage of SC dominated villages covered in the district is % (which is slightly higher than Proportion of General - 43%, SC 24%, ST% the state average, i.e., 24%) 25, OBC 7% households Percentage of ST dominated villages covered 26% of the FHTC connections are under the in the district is 18% (which is higher than the name of a female member state average, i.e., 1%) Average household size - 4 Higher proportion of **pump operator** >75% positive user experience in 5/5 interviewed at the village level measures **Yes,** the district reported to have any historical incidence of water contamination

#### 3. Findings

#### 3.1. Functionality status of FHTC at household level

#### A. Overall Functionality\* (in %)

Figure 10: Functionality of HH tap connection

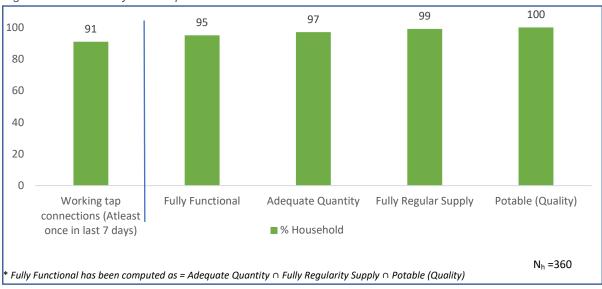

It has been found that 100 percent of the sampled HHs (N=360) had working tap connections (i.e., received water at least once in last 7 days). More than nine out of ten (95 percent) HHs had fully functional tap connection (i.e., HHs receiving adequate quantity of prescribed quality of water on a regular basis).


#### 3.2. Quantity, Regularity, and Quality of Water

Under JJM, functionality is defined as having infrastructure, i.e., household tap connection providing water in adequate quantity (55 LPCD or more) of prescribed quality on regular basis (every day or as decided by GP and/ or its sub-committee) with adequate pressure. It will also include long-term source and system sustainability. Presented here are the findings in this respect.

#### A. Water quantity measured as LPCD (Litres per Capita per Day)


97% HHs reported receiving adequate quantity of water

Figure 11: Quantity of water received by households

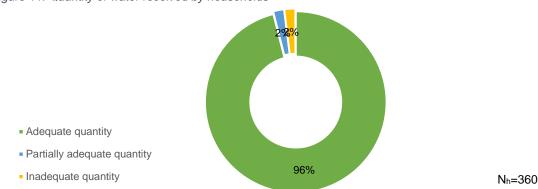

#### Quantity of water received across head, middle, and tail end HHs


Figure 12: Quantity of water received across head, middle and tail end households

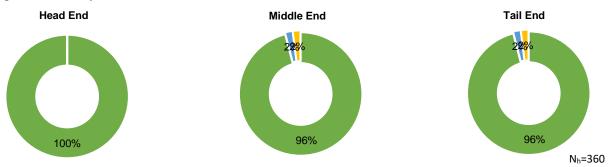

#### B. Regularity of water supply to households


#### 99% HHs receive a regular supply of water (as per agreed schedule)

Figure: Regularity of water received by households

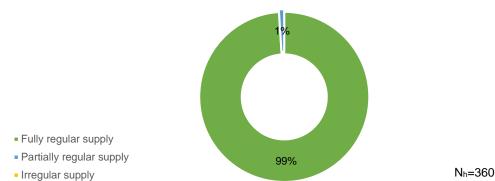


#### Regularity of water received across head, middle, and tail end

Figure 13: Regularity of water received across head, middle and tail end households

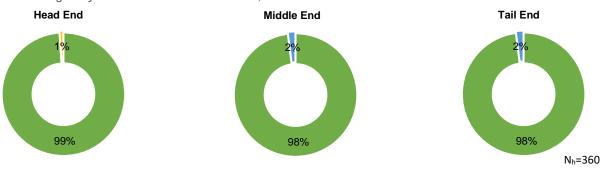

#### C. Water quality - Potability

Figure 14: Potable water received by households

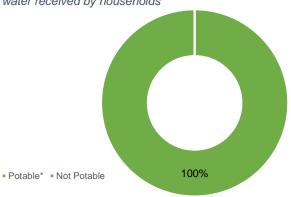

N<sub>h</sub>=360

Table No. 3: Village quality parameters reported within permissible range (% sample within permissible range)

Quality Parameters (N <sub>V</sub> =11)	Water	Samples Tested	from Public Ins	stitutes	
	Anganwadi Centre	Health Facility	Anganwadi Centre	Others	
pH (on-site)	100	100	100	100	
Turbidity	100	100	100	100	
Total Hardness	100	100	100	100	
Total Alkalinity	100	100	100	100	
Chloride	100	100	100	100	
Ammonia	Not tested				
Iron	No history				
Nitrate	100	100	100	100	
Sulphate	100	100	100	100	
Total Dissolved Solids	100	100	100	100	
Bacteriological Test (Absence)	Not tested				
Fluoride	100	100	100	100	
Arsenic		No h	istory		

<sup>\*</sup>Potable water has been considered basis testing of water samples through laboratory tests for physical, chemical, and bacteriological as given in Table 4 parameters (within acceptable/permissible range) and onsite testing of pH. The details of laboratory test are mentioned in the table given above in the glossary.

Table No. 4: Household water quality parameters reported within permissible range in % sample within permissible range)

Quality Parameters	No of samples tested	% Households		
pH (on-site)	360	100		
Turbidity	360	100		
Total Hardness	358	100		
Total Alkalinity	360	100		
Chloride	360	100		
Ammonia	Not tes	Not tested		
Iron	No hist	ory		
Nitrate	360	100		
Sulphate	360	100		
Total Dissolved Solids	360	100		
Bacteriological Test (Absence)	Not tes	ted		
Fluoride	360	100		
Arsenic	No hist	ory		

#### Safeguarding piped water supply for unforeseen bacteriological contamination-Presence of Residual Chlorine (RC)

The Residual Chlorine (RC) in the Nilgiris district was found in 2% samples whereas 98% samples, had no RC.

The Residual Chlorine in piped water supply is one of the most important preventive actions to assure quality of water against bacteriological contamination from source to consumption. The presence of residual chlorine within permissible limits is indicator of well-maintained and healthy piped water supply system.

It is advised that behavioural change communication campaigns on appropriate dosage of residual chlorine is held in all villages and monitoring system for chlorine dosing is established. The FTK must have residual chlorine testing facility for effective WQM&S.


#### **Comment on functioning of District Lab:**

The district lab tested water samples for 8 water quality parameters. 387 water samples were submitted, and 384 water samples were tested, and reports made available. The turnaround time for testing was more than 48 hours in most cases.

The labs did not have any issue with testing the number of water samples submitted nor had any issues with human resource, reagents etc.

#### 3.3. Average water supply days in a week


Figure 15: Average number of days households receive water supply in a week (in %)

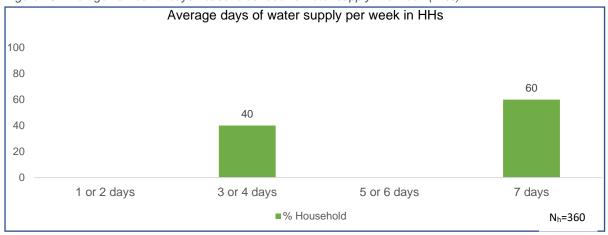

#### 3.4. Household utilization of water for drinking and other activities


**Fulfilment of requirement 94% HHs** reported that their daily requirement of water is being met by FHTCs

Figure 17: Daily household's requirement of water being met by FHTC

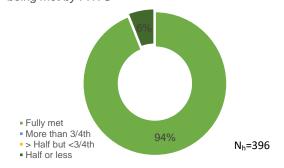


**Primary source of drinking water 36% HHs** reported HH tap connection as their primary source of drinking water

Figure 18: Households reported FHTC as primary source of drinking water

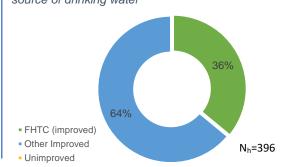

#### 3.5. Status at HH level (Nh=396)



% HHs paying water service delivery charges

% HHs with booster pumps

% HHs having coping mechanism during scarcity

% HH aware of grievance redressal mechanism for reporting problems with FHTC

Channel for registering grievance (N<sub>h</sub>=396\*)

None

Key problems for reporting grievances (N=396)

% Reported complaints
resolved
(N<sub>h</sub>=0)

None


<sup>\*</sup>HHs who reported complaints in last 1 year

#### 3.6. Source sustainability at the village level

#### Schemes based on surface and ground water

9% of schemes are reported to be based on surface water and 91% ground water.

Figure 19: Schemes based on water source in village

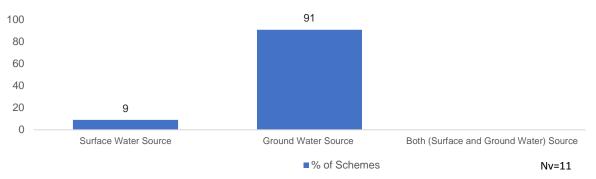


<sup>\*&#</sup>x27;Surface Water Source' is Stream, Spring, Glacier, River, lake, pond etc. and Groundwater Source is open well, borewell, tube well, handpump, spring, etc

#### Villages reported having presence of a groundwater source

82% of villages reported the presence of groundwater sources like improved dug wells and borewells, and % were supported by recharging structures.

Figure 20: Villages reported the presence of groundwater sources and among those how many reported to have a recharge structure

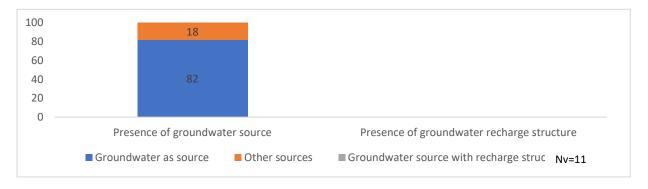


#### The top 3 other source sustainability measure taken by villages

No source sustainability measures taken by any village in the district

### 3.7. Water quality monitoring and surveillance in the villages

Figure 22: Water quality monitoring and surveillance by villages

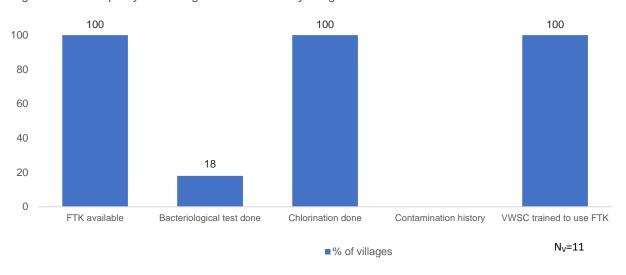

#### 3.8. Status of JJM

### A. VWSC/Pani Samiti and PWS signage in villages (N<sub>v</sub>=11)

Presence of VWSC/Pani Samiti	VWSC/Pani Samiti responsible for O&M of	% Villages – VWSC/PO trained to use FTKs	% Villages in which signages about JJM was	
100%	PWS Schemes  0%	100%	observed 9%	


### B. Water supply, storage and operation & maintenance at village level (N<sub>v</sub>=11)


Average no. of supply in a day	% Villages having skilled manpower for O&M for	% Villages having skilled manpower for O&M for PWS	Community monitoring of water wastage in villages	
2	9%	73%	36%	
% Villages having OHT/ Sump	% Villages having faced O&M challenges	Primary points for reporting grievances	Key problems for reporting grievances	
100%	0%	Other	Pipeline leakage	

#### 3.9. Perception of HHs on Outcome Indicators

#### a. Health b. Economic Income Incidence of water borne diseases at HH level Change in employment days since FHTC in last one year as reported programmes/schemes Figure 24: Household reported a change in Figure 23: Household reported incidence of water employment days since FHTC programmes /schemes borne diseases in last one year 100 80 27% 60 40 20 0 73% Waterborne Water related None Increase diseases diseases No change Nh=396 ■% of HH N<sub>h</sub>=396 - Don't know

# c. Drudgery Reduction in time and effort in collecting water



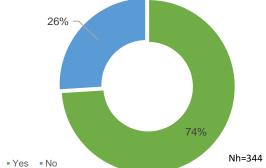

#### 3.10. User satisfaction

Table No. 5: User satisfaction - more than 75% happy with FHTC services				
S. No.	Parameter (N <sub>h</sub> =396) In %			
1	Regularity	(° °)	93	
2	Overall quality		92	
3	Colour	(° °)	92	
4	Taste	(° °)	95	
5	Odour	<u>•</u> •	95	

#### Note:

Base  $(N_v)$ =11 means all villages sampled and covered in Nilgiris district

Base  $(N_H)$ =396 means all households sampled and covered across the 11 villages in Nilgiris district Base  $(N_H)$ =396 means all households where female members used to fetch water before HH tap connection

### 4. Annexures

## 4.1. Summary of villages

Table No. 6: Village Summary						
S.No.	Name of sample village	Sample HHs	Actual sample HHs (achieved)	No. of scheme	No of source of surface water available in the village	No of source of Ground water available in the village
#	Total	396	407	11	1	38
1	Cherangode	36	37	1		4
2	Nellakotta	36	37	1		4
3	Hullathi	36	36	1		4
4	Mulligoor	36	38	1		4
5	Thuneri	36	37	1		5
6	Aracode	36	37	1	1	
7	Denad	36	37	1		4
8	Jackanarai	36	37	1		4
9	Kunjappanai	36	37	1		5
10	Hubbathalai	36	37	1		
11	Melur	36	37	1		4

### 4.2. Functionality – 55 LPCD vs regularity vs potability vs working tap connection

Table	Table No. 7: Functionality of HH tap connection					
S. No.	Village	Functionality* (% HH)	Quantity >=55 LPCD (% HH)	Regularity (% HH)	Potability (% HH)	Working tap connections (%HH)
#	Total	95	97	99	99	100
1	Cherangode	100	100	100	100	100
2	Nellakotta	83	86	97	100	100
3	Hullathi	100	100	100	100	100
4	Mulligoor	97	97	100	100	100
5	Aracode	100	100	100	100	100
6	Denad	97	100	100	97	100
7	Jackanarai	92	97	94	100	100
8	Kunjappanai	83	86	97	100	100
9	Hubbathalai	94	100	97	97	100
10	Melur	100	100	100	100	100
11						

<sup>\*</sup> Fully Functional has been computed as = Adequate Quantity ∩ Fully Regularity Supply ∩ Potable (Quality)

KANTAR PUBLIC HTA

# 4.3. Villages not meeting the quality parameters

S.No.   Block Name	Table No. 8: Quality parameters dissatisfied at village level						
Na	1. pH	pH (Acceptable Range- 6.5 to 8.5)					
2. Free residual chlorine (Acceptable Range- 0.2 to 1 PPM)         HHs outside the acceptable/permissible range chlorine         IHHs with no chlorine           S.No.         Block Name         Panchayat Name         Willages Hubbathalai         HHs outside the acceptable/permissible range chlorine           1         Coonoor         Hubbathalai         Hubbathalai         0         36           2         Melur         Melur         0         28           3         Gudalur         Cherangodu         0         36           4         Nelakotta         Nelakotta         0         36           6         Kothgiri         Arakode         Arakode         0         36           6         Jackanarai         Jackanarai         0         36           7         Kunjappanai         0         36           9         Uthagamandalam         Hullathi         0         35           10         Turbidity (Acceptable Range- 1 to 5 NTU)         Turbidity (Acceptable Range- 1 to 5 NTU           S.No.         Block Name         Panchayat         Villages         HHs outside the acceptable/permissible range           NA         NA         NA         NA         NA         NA           S.No.         Block Name         Panchay			Name	_			
S.No.   Block Name							
S.No.   Block Name   Panchayat Name   Villages   Hirs outside the acceptable/permissible range   no chlorine	2. Fre	ee residual chlorine	(Acceptable Rai	nge- 0.2 to 1 Pl	PM)	I	
1	S.No.	Block Name		Villages		no	
Melur			Name		acceptable/permissible range	chlorine	
3   Gudalur		Coonoor			0	36	
					0	28	
S	3	Gudalur			0	35	
	-				_	36	
		Kothgiri				36	
Denad					_	36	
9 Uthagamandalam 10 Umilgoor						36	
10	8				0	36	
3. Turbidity (Acceptable Range- 1 to 5 NTU)	9	Uthagamandalam				35	
S.No. Block Name NA					0	37	
NA N	3. Tu	rbidity (Acceptable		ΓU)			
NA N	S.No.	Block Name		Villages		rmissible	
4. Total hardness (Acceptable Range- 200 to 600 Milligram/litre)  S.No. Block Name Panchayat NAME NA	NA	NA		NA	i		
S.No. Block Name   Panchayat Name   N							
Name						issible	
NA	S.No.	Block Name		Villages	<u> </u>	1001010	
5. Total alkalinity (Acceptable Range- 200 to 600 Milligram/litre)  S.No. Block Name Panchayat Name Villages Range	NA	NA		NA			
S.No. Block Name   Panchayat Name   Villages   HHs outside the acceptable/permissible range   NA   NA   NA   NA   NA   NA   NA   N							
NA N						issible	
NA	S.No.	Block Name	_	Villages	<u> </u>		
6. Chloride (Acceptable Range- 250 to 1000 Milligram/litre)  S.No. Block Name	NA	NA		NA			
S.No. Block Name   Panchayat Name   Villages   HHs outside the acceptable/permissible range   Panchayat NA   NA   NA   NA   NA   NA   NA   NA							
NA N						issible	
NA	S.No.	Block Name		Villages			
7. Ammonia (Acceptable Range- 0.5 Milligram/litre)  S.No. Block Name Panchayat Name NA NA NA  8. Iron (Acceptable Range- 1 Milligram/litre)  S.No. Block Name Panchayat Name Villages Range- 1 Milligram/litre)  S.No. Block Name Panchayat Name Name Name Name Name Name Name Name	NA	NA		NA			
S.No. Block Name   Panchayat Name   Villages   HHs outside the acceptable/permissible range   NA NA   NA   NA   NA   NA   NA   NA		nmonia (Acceptable	Range- 0.5 Milli		1		
NA   NA   NA   NA   NA   NA   NA   NA		-			HHs outside the acceptable/perm	issible	
NA	S.No.	Block Name		Villages			
8. Iron (Acceptable Range- 1 Milligram/litre) S.No. Block Name Panchayat Name Villages Panchayat Name Panchayat Name Panchayat Name Panchayat Name Panchayat Name Panchayat Name Villages Panchayat Name Panchayat Name Panchayat Name NA	NA	NA		NA			
S.No. Block Name Panchayat Name Villages range  1 Coonoor Hubbathalai Hubbathalai 1 2 Kothgiri Denad Denad 1  9. Nitrate (Acceptable Range- 1 Milligram/litre)  S.No. Block Name Panchayat Name Villages range  NA NA NA NA NA NA NA  10. Sulphate (Acceptable Range- 200 to 400 Milligram/litre)  S.No. Block Name Panchayat Name Villages range  NA NA NA NA NA NA  11. Total dissolved solids (Acceptable Range- 500 to 2000 Milligram/litre)  S.No. Block Name NA NA NA  12. Bacteriological test (Presence - Absence Test for Hydrogen Sulphide producing organisms (H2S))  S.No. Block Name Panchayat NA NA NA NA  NA NA NA NA NA NA NA  NA NA NA NA NA NA  NA NA NA NA NA NA NA  NA NA NA NA NA NA NA  NA NA NA NA NA NA  NA NA NA NA NA NA NA NA  NA NA NA NA NA NA NA NA  NA NA NA NA NA NA NA NA  NA NA NA NA NA NA NA NA NA  NA NA NA NA NA NA NA NA NA  NA NA NA NA NA NA NA NA NA NA NA  NA NA NA NA NA NA NA NA NA NA NA NA NA N		n (Acceptable Rand	ge- 1 Milligram/lit		1		
S.No.   Block Name   Name   Villages   range					HHs outside the acceptable/perm	issible	
1 Coonoor Hubbathalai Hubbathalai 1 2 Kothgiri Denad Denad 1  9. Nitrate (Acceptable Range- 1 Milligram/litre)  S.No. Block Name Panchayat Name NA NA NA NA  10. Sulphate (Acceptable Range- 200 to 400 Milligram/litre)  S.No. Block Name Panchayat Name NA NA NA NA  11. Total dissolved solids (Acceptable Range- 500 to 2000 Milligram/litre)  S.No. Block Name Panchayat NA NA NA  11. Total dissolved solids (Acceptable Range- 500 to 2000 Milligram/litre)  S.No. Block Name Panchayat NA NA NA  12. Bacteriological test (Presence - Absence Test for Hydrogen Sulphide producing organisms (H2S))  S.No. Block Name NA NA NA NA NA NA NA  14. Block Name NA	S.No.	RIOCK Name	l	Villages	· · ·		
2 Kothgiri Denad Denad 1  9. Nitrate (Acceptable Range- 1 Milligram/litre)  S.No. Block Name Panchayat Name NA NA NA NA  10. Sulphate (Acceptable Range- 200 to 400 Milligram/litre)  S.No. Block Name Panchayat Name Villages HHs outside the acceptable/permissible range  NA NA NA NA NA NA  11. Total dissolved solids (Acceptable Range- 500 to 2000 Milligram/litre)  S.No. Block Name Panchayat NA NA NA  11. Total dissolved solids (Acceptable Range- 500 to 2000 Milligram/litre)  S.No. Block Name Panchayat Name Villages HHs outside the acceptable/permissible range  NA NA NA NA NA NA NA NA  12. Bacteriological test (Presence - Absence Test for Hydrogen Sulphide producing organisms (H2S))  S.No. Block Name Panchayat Name Villages HHs outside the acceptable/permissible range  NA N	1	Coonoor		Hubbathalai		1	
9. Nitrate (Acceptable Range- 1 Milligram/litre) S.No. Block Name Panchayat Name NA	2					1	
S.No. Block Name Panchayat Name Villages HHs outside the acceptable/permissible range  NA NA NA NA NA NA NA  10. Sulphate (Acceptable Range- 200 to 400 Milligram/litre)  S.No. Block Name Panchayat Name NA NA NA  11. Total dissolved solids (Acceptable Range- 500 to 2000 Milligram/litre)  S.No. Block Name Panchayat NA NA NA  12. Bacteriological test (Presence - Absence Test for Hydrogen Sulphide producing organisms (H2S))  S.No. Block Name Panchayat Name Villages Panchayat Name NA							
NA N	S.No.		Panchayat		<u> </u>	issible	
10. Sulphate (Acceptable Range- 200 to 400 Milligram/litre)  S.No. Block Name Panchayat Name Villages Panchayat Name  NA NA NA NA NA NA NA  11. Total dissolved solids (Acceptable Range- 500 to 2000 Milligram/litre)  S.No. Block Name Panchayat Name Villages Panchayat Name  NA NA NA NA NA NA  12. Bacteriological test (Presence - Absence Test for Hydrogen Sulphide producing organisms (H2S))  S.No. Block Name Panchayat Name Villages Panchayat Name NA	NIA	NΙΛ		_			
S.No. Block Name Panchayat Name Villages HHs outside the acceptable/permissible range  NA NA NA NA NA NA NA  11. Total dissolved solids (Acceptable Range- 500 to 2000 Milligram/litre)  S.No. Block Name Panchayat Name NA NA NA NA  12. Bacteriological test (Presence - Absence Test for Hydrogen Sulphide producing organisms (H2S))  S.No. Block Name Panchayat Name Villages HHs outside the acceptable/permissible range  NA					I.		
NA N	10. Su	ipnate (Acceptable		יט wiiiigram/liti			
11. Total dissolved solids (Acceptable Range- 500 to 2000 Milligram/litre)  S.No. Block Name Panchayat Name NA	S.No.	Block Name		Villages	<u> </u>	issible	
11. Total dissolved solids (Acceptable Range- 500 to 2000 Milligram/litre)  S.No. Block Name Panchayat Name NA	NA	NA		NA	NA		
S.No. Block Name Panchayat Name Villages HHs outside the acceptable/permissible range  NA NA NA NA NA NA  12. Bacteriological test (Presence - Absence Test for Hydrogen Sulphide producing organisms (H2S))  S.No. Block Name Panchayat Name Villages HHs outside the acceptable/permissible range  NA NA NA NA NA NA NA	11. Total dissolved solids (Acceptable Range- 500 to 2000 Milligram/litre)						
NA NA NA NA NA NA NA NA  12. Bacteriological test (Presence - Absence Test for Hydrogen Sulphide producing organisms (H2S))  S.No. Block Name Panchayat Name Villages HHs outside the acceptable/permissible range  NA NA NA NA NA NA NA			Panchayat		HHs outside the acceptable/perm	issible	
12. Bacteriological test (Presence - Absence Test for Hydrogen Sulphide producing organisms (H2S))       S.No.     Block Name     Panchayat Name     Villages     HHs outside the acceptable/permissible range       NA     NA     NA     NA	NΙΛ	NΙΛ		NΙΛ			
S.No. Block Name Panchayat Name Villages HHs outside the acceptable/permissible range NA NA NA NA NA						me (Hael)	
NA NA NA NA NA	12. Ba	cteriological test (F		le rest for Hy			
				~	range	ISSIDIE	
13. Fluoride (Acceptable Range- 1 to 1.5 Milligram /litre)	NA				NA		
	13. Flu	uoride (Acceptable	Range- 1 to 1.5 M	lilligram /litre)			



Table I	Table No. 8: Quality parameters dissatisfied at village level					
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range		
NA	NA	NA	NA	NA		
14. Ar	14. Arsenic (in hotspots) (Acceptable Range- 0.01 Milligram /litre)					
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range		
NA	NA	NA	NA	NA		