



# **Functionality Assessment of Household Tap Connection under National Jal Jeevan Mission - 2022**



**District Report: South Goa, Goa**  
**Survey Duration: March to April 2022**

## Contents

Abbreviations .....	3
Glossary .....	4
1. Factsheet.....	6
2. Context .....	8
2.1. District snapshot: South Goa .....	8
2.2. FHTC Assessment Objectives .....	9
2.3. Assessment Methodology .....	9
2.4. Sample Size .....	9
2.5. Sampling Methodology.....	10
2.6. Methodology for Water Quantity Measurement at Households .....	11
2.7. Methodology for Water Quality Measurement .....	11
2.8. Project implementation.....	12
2.9. Sample coverage .....	13
2.10. Sampled village and household profile .....	13
3. Findings.....	14
3.1. Functionality status of FHTC at household level.....	14
3.2. Quantity, Regularity, and Quality of Water.....	15
3.3. Average water supply days in a week.....	18
3.4. Household utilization of water for drinking and other activities .....	18
3.5. Status at HH level (Nh=1581) .....	18
3.6. Source sustainability at the village level .....	19
3.7. Water quality monitoring and surveillance in the villages .....	20
3.8. Status of JJM.....	20
3.9. Perception of HHs on Outcome Indicators.....	21
3.10. User satisfaction.....	22
4. Annexures .....	23
4.1. Summary of villages.....	23
4.2. Functionality – 55 LPCD vs regularity vs potability vs working tap connection .....	25
4.3. Villages not meeting the quality parameters .....	27

## Abbreviations

AWC	Aanganwadi Centre
FHTC	Functional Household Tap Connection
Gol	Government of India
GP	Gram Panchayat
HF	Health Facility
HH	Household
HGJ	Har Ghar Jal
JJM	Jal Jeevan Mission
LPCD	Litres per Capita per Day
MVS	Multi-village Scheme
NJJM	National Jal Jeevan Mission
RC	Residual Chlorine
O&M	Operation and Maintenance
OHT	Over Head Tank
PSU	Primary Sampling Unit
PWS	Piped Water Supply
SVS	Single Village Scheme
VAP	Village Action Plan
VWSC	Village Water and Sanitation Committee
WQMIS	Water Quality Monitoring and Information System

## Glossary

1. **Community** – Group of people living in one particular area or village/habitation
2. **Cross-sectional research** – A cross-sectional study is a type of research design in which data is collected from a relatively large and diverse group of people at a single point in time
3. **Drinking water source** – Groundwater (open well, borewell, tube well, handpump, spring, etc.)/ surface water (river, lake, pond, reservoir, etc.)/rainwater, available for drinking and domestic use
4. **Improved sources** – The following sources as considered improved by the National Family Health Survey definitions: Piped water into dwelling, yard/plot with a tap, piped water connected to public stand-posts, tube well or borewell, Hand pump, dug well–protected, Spring–protected, Rainwater, Water ATM/ Community RO plant/ Community Water Purification Plant (CWPP)
5. **Unimproved sources** – The following sources as considered unimproved by the National Family Health Survey definitions: Unprotected spring, unprotected dug well, cart with small tank / drum, Tanker/ truck, Surface water (river/ dam/ lake/ pond/ canal), and bottled water
6. **Functional Household Tap Connection (FHTC)** – A tap connection to a rural household for providing drinking water in adequate quantity of prescribed quality on regular basis.
7. **Functionality of FHTC** – Functionality of a tap connection is defined as having infrastructure, i.e., household tap connection providing water in adequate quantity, as presented:

Definitions	Fully-functional	Partially-functional	Non-functional
Quantity	$\geq 55$ LPCD	$> 40$ lpcd - $< 55$ LPCD	$< 40$ LPCD
Regularity	12 months or daily basis	9-12 months or $<$ daily basis	$< 9$ months or $<$ daily basis
Quality	Potable	Potable	Non potable

8. **Quantity (in litres)** of water received by households per person per day should meet the service level of 55 lpcd.
9. **Functionality Assessment** – An assessment of the functionality of rural household tap connections based on a sample survey
10. **Fully Regular** – Regularity of water is considered when a rural household receives water for 12 months on daily basis or as per schedule.
11. **Potability** – Potable water is water that is safe to be used as drinking water. Parameters of potable water are mentioned below:

Parameters for potable water tested in the survey	Unit	Acceptable Limit	Permissible Limit in the absence of alternative sources
i. pH (tested on site)	-	6.5 to 8.5	No relaxation
ii. Free residual chlorine (tested on site)	Mg/litre	0.2	1
iii. Turbidity	NTU	1	5
iv. Total hardness	Mg/litre	200	600
v. Total alkalinity	Mg/litre	200	600
vi. Chloride	Mg/litre	250	1000
vii. Ammonia	Mg/litre	0.5	No relaxation
viii. Phosphate	Mg/litre	0.3	1
ix. Iron (in hotspots only)	Mg/litre	1	No relaxation
x. Nitrate	Mg/litre	45	No relaxation
xi. Sulphate	Mg/litre	200	400
xii. Total dissolved solids	Mg/litre	500	2000

xiii.	Fluoride	Mg/litre	1	1.5
xiv.	Arsenic (in hotspots only)	Mg/litre	0.01	No relaxation
xv.	Bacteriological test for Total coliform bacteria and E. coli or thermotolerant coliform bacteria		Shall not be detectable in any 100 ml sample	

12. **Sampling** – Selection of a subset of individuals from within a statistical population to estimate water service delivery among the population. In the current study, households have been sampled to estimate the representation of the village and subsequently of the district as well as of the state.
13. **Types of schemes:** Following are the piped water supply schemes that were assessed
  - a. Mini-solar based piped water supply scheme in isolated/tribal hamlets
  - b. Single Village Scheme (SVS) in villages having adequate groundwater that needs treatment
  - c. Single village scheme (having adequate groundwater/ spring water/ local or surface water source of prescribed Quality)
  - d. Retrofitting of ongoing schemes taken up under erstwhile NRDWP for the last mile connectivity/ retrofitting of completed rural water supply schemes to make it JJM compliant
  - e. Multi-village PWS scheme - with water grids/ regional water supply schemes
14. **Village Action Plan (VAP)** – Plan prepared by Gram Panchayat and/ or its sub-committee, i.e., VWSC/ Paani Samiti/ User Group, etc. based on baseline survey, resource mapping and felt needs of the village community to provide FHTC to every rural household, treat the generated greywater and plan its reuse, undertake surveillance activities, etc. VAP also indicates the fund requirement and timelines for completion of work under the Mission and will be approved by the Gram Sabha. Irrespective of the source of funding, all drinking water-related works in the village are taken up based on the VAP.
15. **Source Sustainability** – includes measures such as aquifer recharge, rainwater harvesting, increased storage capacity of water bodies, reservoirs, de-silting, etc. improve the lifespan of water supply systems
16. **Har Ghar Jal (HGJ)** – An administrative unit wherein all HHs are provided with water supply through FHTCs is called “Har Ghar Jal”.
17. **Public Institutions** – The public institutions in the survey include Aanganwadi Centre (AWC), Health Facilities, Schools, Gram Panchayat, and government buildings.
18. **Working tap connection** – A tap connection supplied water at least one day in the week, preceding of survey
19. **Functional Scheme** – A scheme is said to be functional if it was reported to be working for all 12 months in a year.

## 1. Factsheet

Table 1: District level factsheet

Indicators	State	District
<b>Functionality status of FHTC at households</b>		
Households (HHs) which received water through FHTC at least once in last 7 days (%)	100	100
Fully functional (%)	81	81
Partially functional (%)	17	16
Non-functional (%)	2	3
<b>Quantity of water received by households</b>		
Adequate quantity (>55 LPCD) (%)	97	96
Partially adequate quantity (> 40 LPCD - < 55 LPCD) (%)	1	1
Inadequate quantity (<40 LPCD) (%)	2	3
<b>Regularity of water received by households</b>		
Fully Regular Supply (as per schedule) (%)	93	96
Partially Regular Supply (not as per schedule) (%)	3	2
Irregular Supply (less than 9 months' supply) (%)	4	3
<b>Potable (Quality) water received by households</b>		
Potable (%)	90	89
Non-potable (%)	10	11
Residual Chlorine (RCL) detected with in permissible limits (%)	72	64
<b>Household level indicators</b>		
Households receiving water supply daily-7 days a week (%)	90	96
Daily HH requirement of water being met by FHTC (%)	99	99
Households reported FHTC as a primary source of drinking water (%)	95	98
Households purifying water before drinking (%)	89	93
Households paying water service delivery charges (%)	90	92
Households having coping mechanisms during scarcity (%)	33	28
Households aware of grievance redressal mechanism for reporting problems with FHTC (%)	82	82
Households reported incidence of water-borne diseases in the last year (%)	0	0
Households reported a reduction in time and effort in collecting water (%)	94	95
<b>Overall user satisfaction at the household level</b>		
Regularity (%)	98	96
Overall quality (%)	97	95

Indicators	State	District
<b>Village level indicators (based on village questionnaire)</b>		
Schemes reported to be functional (%)	46	43
Villages with groundwater resource (%)	20	21
Villages having groundwater recharge structure <sup>1</sup> (%)	5	7
<b>Water supply and storage status in villages</b>		
Average no. of times water is supplied in a day	2	2
Villages having OHT/ Sump for storage of water (%)	48	31
<b>Water quality monitoring and surveillance in the villages</b>		
Villages with Field Test Kits (%)	11	12
Villages in which bacteriological test was done in last 1 year by VWSC/ Pani Samiti (%)	17	17
Villages reported to have a mechanism for chlorination (%)	5	1
<b>VWSC/Pani Samiti and PWS signage in villages</b>		
Village reported having presence of VWSC/ Pani Samiti (%)	20	23
Villages in which VWSC/ Pani Samiti is responsible for Operation & Maintenance of PWS schemes (%)	5	2
Villages in which persons are trained to use Field Test Kits (%)	18	17
Villages in which signages about JJM were observed (%)	2	2
<b>Operation and maintenance at village</b>		
Villages levying water service delivery to households (%)	78	82
Convergence of JJM activities with other schemes in the villages (%)	2	1
Villages having skilled manpower for Operation & Maintenance of PWS schemes (%)	30	32
Community monitoring of water wastage in villages (%)	19	22

<sup>1</sup> Out of villages who reported to have groundwater source (N<sub>v</sub>=20)



## 2. Context

Jal Jeevan Mission (JJM) was launched on the 15th of August 2019 with the objective to provide functional household tap connections (FHTCs) to all rural households.

Figure 1: Har Ghar Jal - Objective, Vision, & Outcome



In accordance with the overall objectives as specified in the Operational Guidelines for the implementation of the NJJM, GoI carried out a sample survey to assess the functionality of household tap connections. As part of this endeavour, NJJM, GoI engaged HTA Kantar Public to conduct the 'Functionality Assessment' of the household as well as public institution/ buildings such as schools, anganwadis, gram panchayat buildings, public health facilities, and wellness centers in all the rural districts for the fiscal year 2021-22.

### 2.1. District snapshot: South Goa


District South Goa of Goa has a population of 4,23,066. The district has 6 blocks. Out of 147 villages in the district, none of them are SC dominated and 42 are ST dominated villages. The district lies in West Coast Plains and Hills Region and receives an annual rainfall of 3134.9mm.

Presented here are district level information collated from the DDWS-IMIS:

Figure 2: District IMIS Status & Map

#### IMIS status:

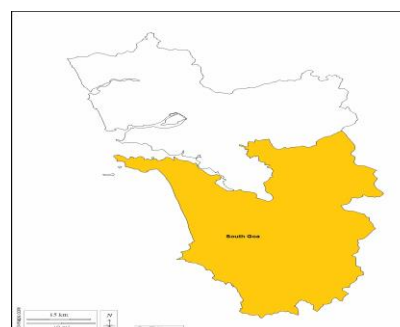- 147 (100% of all) villages are Har Ghar Jal
- 0 (0% of all) villages are Non-Har ghar Jal
- Non-SC/ST dominated district
- Non JE/AES
- Yes- History of water contamination
- 142 (97% of all) villages with PWS more than 20 FHTC





## 2.2. FHTC Assessment Objectives


Figure 3: Objectives of Functionality of Tap Connections



## 2.3. Assessment Methodology

A cross-section research design has been used for this functionality assessment study. Quantitative data were collected from villages and households across all states/UTs using the CAPI (Computer Assisted Personal Interviewing) mode. The survey includes two components, village, and household.

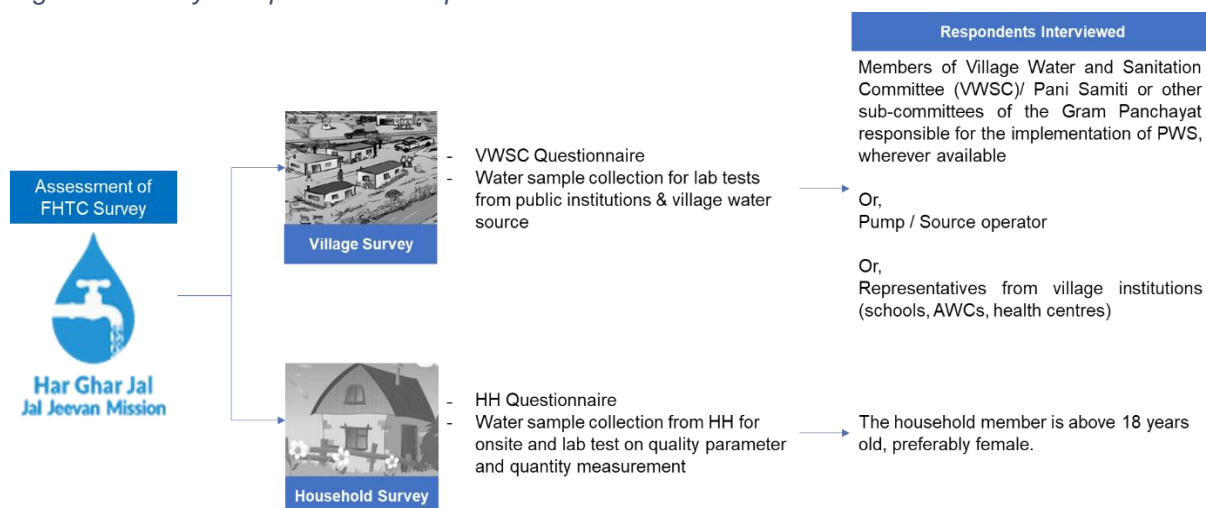Figure 4: Survey Components & Respondents



## 2.4. Sample Size

The sample size was calculated to provide estimates with a 95% confidence interval (CI) and 5% margin of error (MoE) after incorporating the correction factor for a finite population considering the total number of geographic units having FHTCs.

- Village sample is estimated to be representative at the state level
- HH sample estimated to be representative at the district level

- Number of Har Ghar Jal (HGJ) villages were proportionately sampled at the district level
- All PWS schemes (up to 4) were covered per village. Per scheme approximately 9 (3 each from the head, middle, and tail HHs) or 18 households (6 each from head, middle, and tail HHs) were sampled to achieve the desired sample at the district level.

## 2.5. Sampling Methodology

As per the design, all villages having a PWS scheme with 20 or more functional household tap connections were included in the sample frame. The probability proportionate to size (PPS) method was used for village selection in each district. The steps for random selection of villages using PPS are as presented:

Figure 5: Steps for Village Sampling



The key considerations for the village and household sampling were:

Figure 6: Sampling Considerations – Village & Households



The record of all district-wise village replacements is maintained and reported as part of the annexure.

## 2.6. Methodology for Water Quantity Measurement at Households

Figure 7: Steps for Measuring Flowrate from Supply-tap at HHs



The flow rate of the water supply was measured using a container with gradual markings (either 5 litres or 1 litre, based on the flow of the tap) and a stopwatch/timer-watch. The process followed is as described in Figure 7.

In the case of households where the FHTC is connected directly with the storage tank, the following steps were adopted to measure the quantity:

- Assessor first asked and recorded length, breadth, and height.
- Assessor dipped a 5 feet long rod, marked the level of the water table, and calculated the volume – length x breadth x-height of water.
- Next the assessor opened the valve of the connection and allowed the water to flow inside the storage for 10 minutes.
- After 10 mins, the valve was closed, and the assessor again dipped the rod and recorded the new height of the water inside the tank. Based on this new 'height' and the CAPI calculated the changed volume.
- The difference in the volume of water in 10 minutes divided by 10 provided the flow rate of the water supply per minute.

The water flow rate was not measured for village-level public institutions.

## 2.7. Methodology for Water Quality Measurement

Water quality was tested for all public institutions available in the villages, including schools, anganwadis, gram panchayat buildings, public health facilities, and wellness centers, and at the selected households. Two types of quality tests were carried out – a) spot test for pH and free residual chlorine, and b) water sample was collected and transported to labs for testing against 13 quality parameters (total 15) as specified in Figure 8.

Figure 8: On-site & Laboratory Based Quality Test



JJM, with the support of the BMI Division of ICMR, enabled a new interface on the WQMIS portal for “Functionality Assessment (FA) User” to enable seamless harmonization of water sample registration, sample submission for testing, and sharing of results as per the applicable quality parameters.

## 2.8. Project implementation

An overview of the project implementation is as presented:

Figure 9: Broad project implementation framework



A total of 5 teams (comprising 5 supervisors, 30 assessors, and 5 water collection assistants) were recruited, trained, and deployed to complete the survey across the state of Goa. One survey team covered approximately 2 – 3 districts. The state-wise team deployment and fieldwork dates were as presented:

Table No. 1: State-wise team deployment and data collection start & end dates				
State	Teams deployed	Start date	End date	Total data collection days
Goa	5 Teams	3/5/2022	4/1/2022	26 days

A four-tier quality control (QC) system was put in place. At the ground level, the data collection exercise was done using a computer-aided Personal Interview (CAPI) application which contained all logic and skip-checks inbuilt. Also, 5% of the total samples were accompanied by the supervisors. Sub-targeted QC was done by the state field managers (5%) and the central project management team (5%). Apart from this, the central research team monitored the data trend and as per requirement debriefed data collection teams to improve quality.

## 2.9. Sample coverage

Table No. 2: Sample covered					
District	Targeted sample		Achieved sample		
	Village	HH	Village	HH	Public Institutions
South Goa	94	1,548	94	1,581	279
Goa	189	2,790	189	2,834	639

## 2.10. Sampled village and household profile


SAMPLED VILLAGES	SAMPLED HOUSEHOLDS
<ul style="list-style-type: none"> <li>Total no. of villages covered in the district – 94</li> <li>Percentage of SC dominated villages covered in the district is 0% (which is equal to the state average, i.e., 0%)</li> <li>Percentage of ST dominated villages covered in the district is 20% (which is higher than the state average, i.e., 13%)</li> <li><b>Yes</b> the district reported to have any historical incidence of water contamination</li> </ul>	<ul style="list-style-type: none"> <li>Total no. of households covered in the district – <b>1,581</b></li> <li>Proportion of General - 85%, SC 3%, ST% 9, OBC 3% households</li> <li><b>34%</b> of the FHTC connections are under the name of a female member</li> <li>Average household size – 5</li> <li><b>&gt;75%</b> positive user experience in 5/5 measures</li> </ul>

### 3. Findings

#### 3.1. Functionality status of FHTC at household level

##### A. Overall Functionality\* (in %)

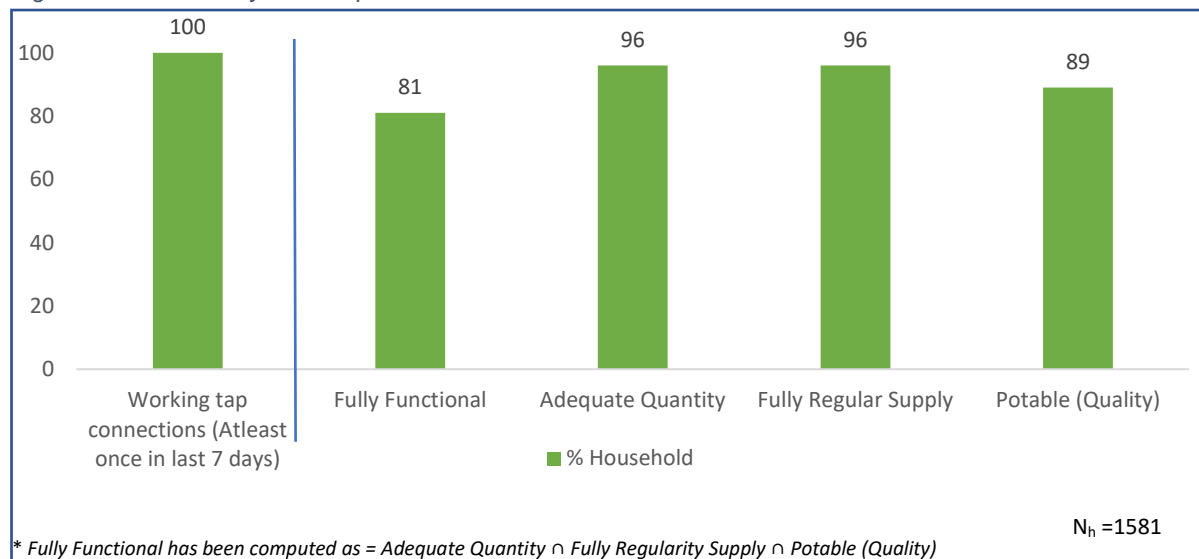Figure 10: Functionality of HH tap connection



It has been found that 100 percent of the sampled HHs (N=1,581) had working tap connections (i.e., received water at least once in last 7 days). More than eight out of ten (81 percent) HHs had fully functional tap connection (i.e., HHs receiving adequate quantity of prescribed quality of water on a regular basis).


### 3.2. Quantity, Regularity, and Quality of Water

Under JJM, functionality is defined as having infrastructure, i.e., household tap connection providing water in adequate quantity (55 LPCD or more) of prescribed quality on regular basis (every day or as decided by GP and/ or its sub-committee) with adequate pressure. It will also include long-term source and system sustainability. Presented here are the findings in this respect.

#### A. Water quantity measured as LPCD (Litres per Capita per Day)


**96% HHs** reported receiving adequate quantity of water

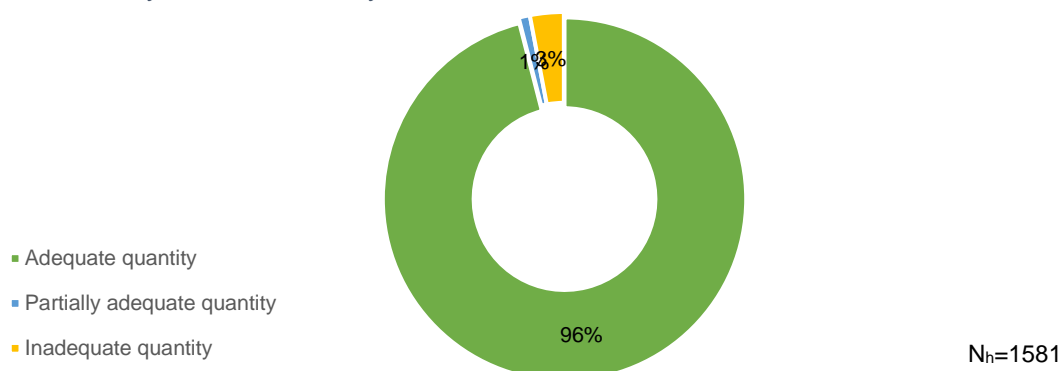Figure 11: Quantity of water received by households



#### Quantity of water received across head, middle, and tail end HHs

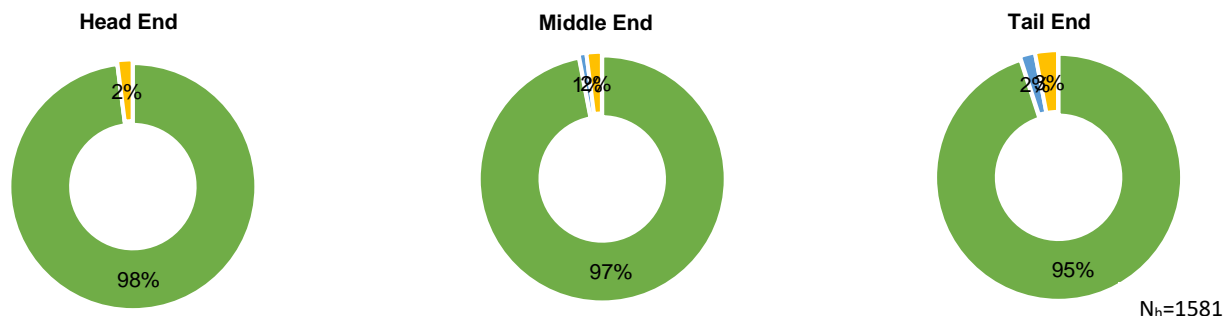
Figure 12: Quantity of water received across head, middle and tail end households



#### B. Regularity of water supply to households

**96% HHs** receive a regular supply of water (as per agreed schedule)

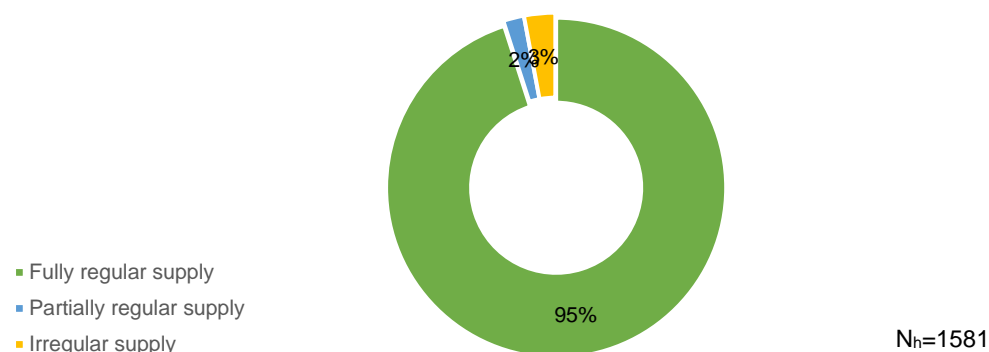
Figure: Regularity of water received by households






### Regularity of water received across head, middle, and tail end

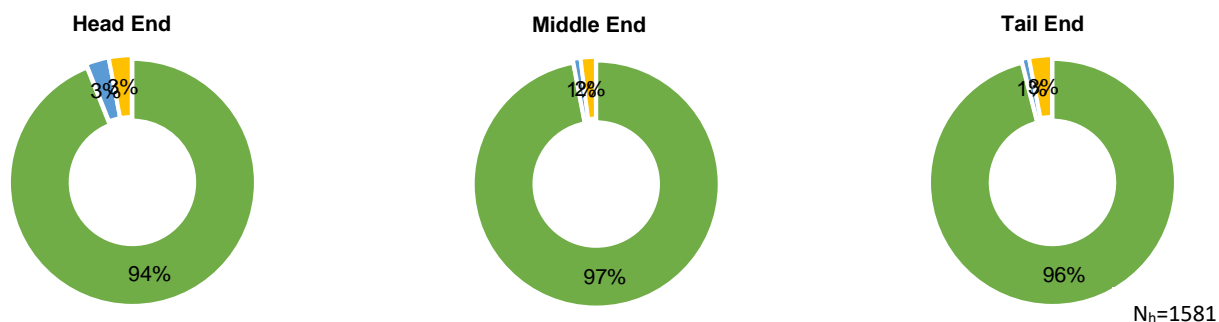Figure 13: Regularity of water received across head, middle and tail end households



### C. Water quality – Potability

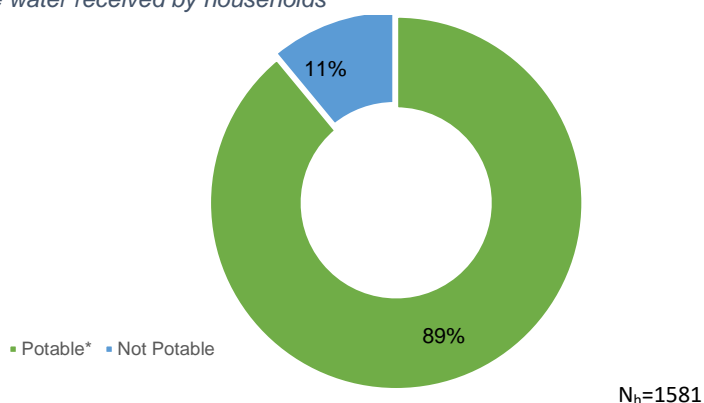Figure 14: Potable water received by households



\*Potable water has been considered basis testing of water samples through laboratory tests for physical, chemical, and bacteriological as given in Table 4 parameters (within acceptable/ permissible range) and onsite testing of pH. The details of laboratory test are mentioned in the table given above in the glossary.

**Table No. 3: Village quality parameters reported within permissible range (% sample within permissible range)**

Quality Parameters (NV=94)	Water Samples Tested from Public Institutes			
	Anganwadi Centre	Health Facility	Schools	Others
pH (on-site)	91	94	92	92
Turbidity	100	100	100	100
Total Hardness	100	100	100	100
Total Alkalinity	100	100	100	100
Chloride	100	100	100	100
Ammonia	Not tested			
Iron	Not tested			
Nitrate	Not tested			
Sulphate	Not tested			
Total Dissolved Solids	100	100	100	100
Bacteriological Test	100	100	100	100
Fluoride	No history			
Arsenic	No history			

**Table No. 4: Household water quality parameters reported within permissible range (in % sample within permissible range)**

Quality Parameters	No of samples tested	% Households
pH (on-site)	1581	90
Turbidity	1451	99
Total Hardness	777	100
Total Alkalinity	1536	100
Chloride	605	100
Ammonia	Not tested	
Iron	Not tested	
Nitrate	Not tested	
Sulphate	Not tested	
Total Dissolved Solids	879	100
Bacteriological Test (Absence)	1485	100
Fluoride	No history	
Arsenic	No history	

#### **Safeguarding piped water supply for unforeseen bacteriological contamination- Presence of Residual Chlorine (RC)**

The Residual Chlorine (RC) in the South Goa district was found in 64% samples. The remaining 36% of the samples had no RC. It may be mentioned that 100% of water samples passed the bacteriological contamination test but to assure the protection against bacteriological contamination, addition of RC is must in PWS system.

The Residual Chlorine in piped water supply is one of the most important preventive actions to assure quality of water against bacteriological contamination from source to consumption. The presence of residual chlorine within permissible limits is indicator of well-maintained and healthy piped water supply system.

It is advised that behavioural change communication campaigns on appropriate dosage of residual chlorine is held in all villages and monitoring system for chlorine dosing is established. The FTK must have residual chlorine testing facility for effective WQM&S.


#### **Comment on functioning of District Lab:**

The district lab tested water samples for 6 water quality parameters. 1,860 water samples were submitted, and 1,772 water samples were tested, and reports made available. The turnaround time for testing was more than 48 hours in most cases.

The labs did not have any issue with testing the number of water samples submitted nor had any issues with human resource, reagents etc.

### 3.3. Average water supply days in a week

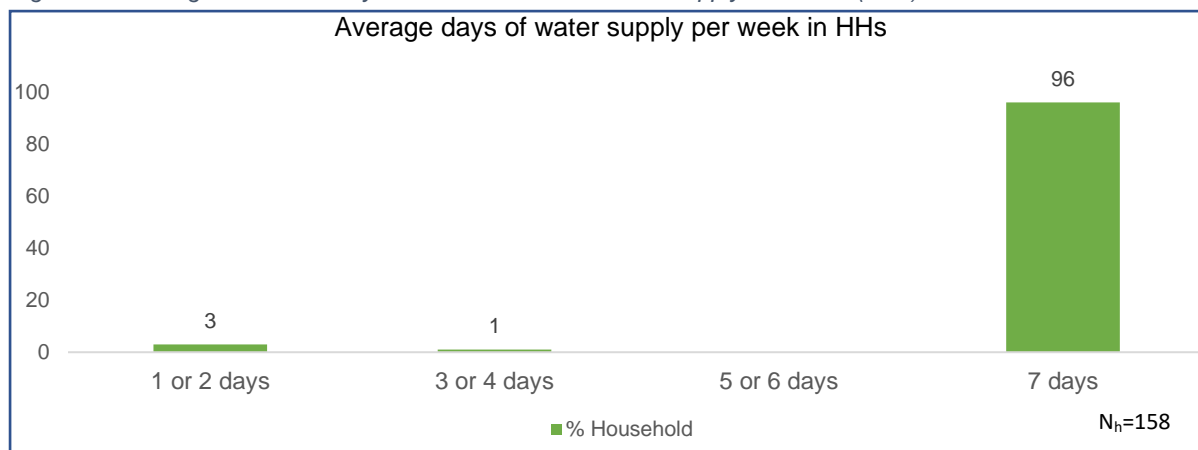Figure 15: Average number of days households receive water supply in a week (in %)




### 3.4. Household utilization of water for drinking and other activities

#### Fulfilment of requirement

**99% HHs** reported that their daily requirement of water is being met by FHTCs

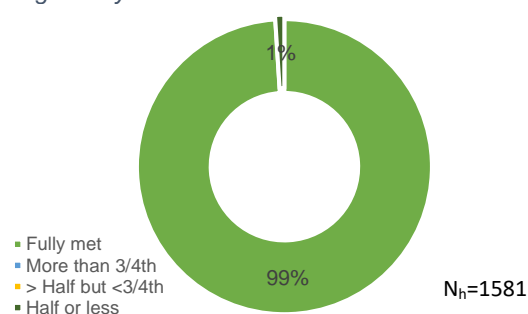
Figure 17: Daily household's requirement of water being met by FHTC



#### Primary source of drinking water

**98% HHs** reported HH tap connection as their primary source of drinking water

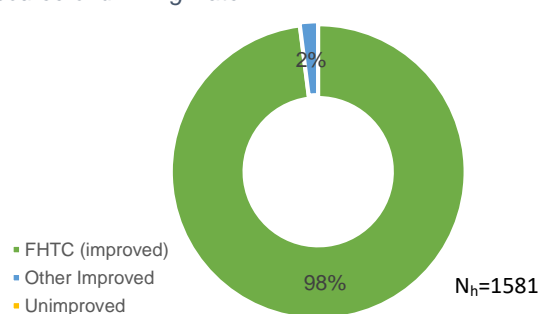Figure 18: Households reported FHTC as primary source of drinking water



### 3.5. Status at HH level (Nh=1581)

% HHs purifying water before drinking	% HHs paying water service delivery charges	% HHs with booster pumps	% HHs having coping mechanism during scarcity
93%	92%	24%	28%
% HH aware of grievance redressal mechanism for reporting problems with FHTC	Channel for registering grievance (Nh=1581*)	Key problems for reporting grievances (N=1581)	% Reported complaints resolved (Nh=47)
82%	Pump-operator	Pipeline Leakage	55%


\*HHs who reported complaints in last 1 year

### 3.6. Source sustainability at the village level

#### Schemes based on surface and ground water

18% of schemes are reported to be based on surface water and 16% ground water.

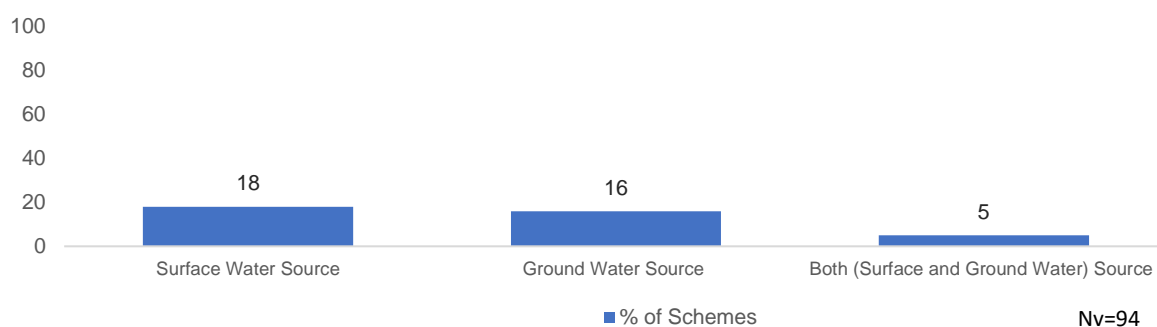Figure 19: Schemes based on water source in village




\*'Surface Water Source' is Stream, Spring, Glacier, River, lake, pond etc. and Groundwater Source is open well, borewell, tube well, handpump, spring, etc

#### Villages reported having presence of a groundwater source


21% of villages reported the presence of groundwater sources like improved dug wells and borewells and 7% were supported by recharging structures.

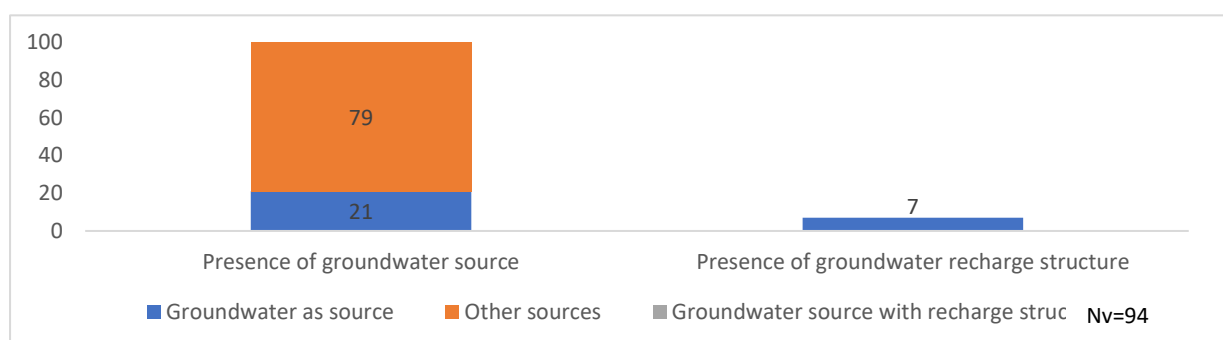Figure 20: Villages reported the presence of groundwater sources and among those how many reported to have a recharge structure




#### The top 3 other source sustainability measure taken by villages

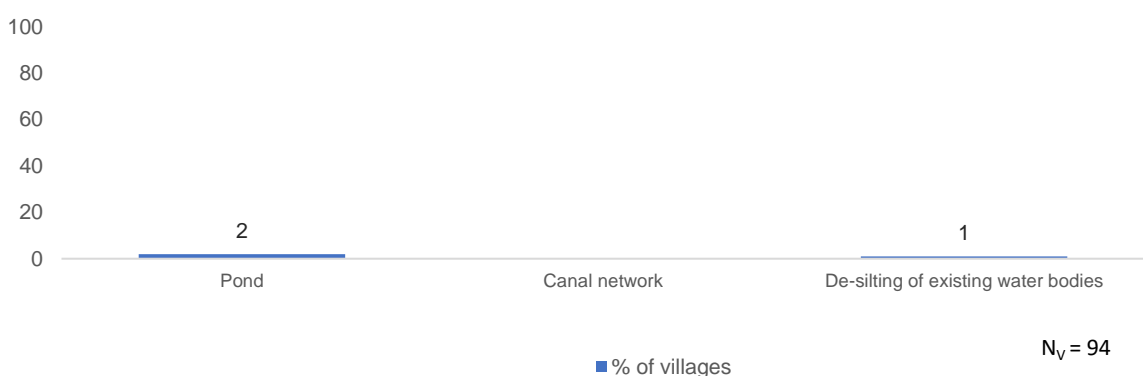Figure 21: Villages reported having taken other source sustainability measure



### 3.7. Water quality monitoring and surveillance in the villages

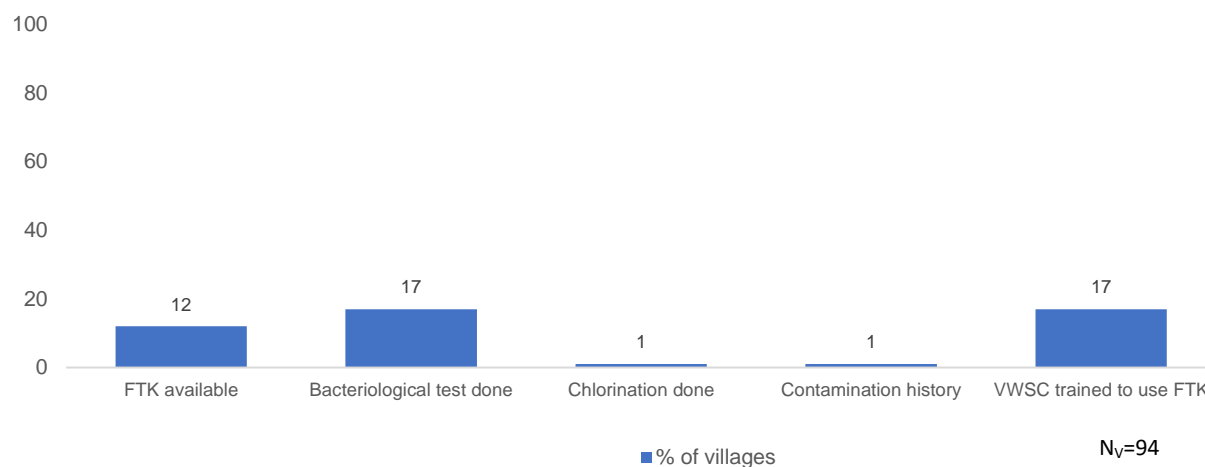Figure 22: Water quality monitoring and surveillance by villages



### 3.8. Status of JJM

#### A. VWSC/Pani Samiti and PWS signage in villages (N<sub>v</sub>=94)

Presence of VWSC/Pani Samiti	VWSC/Pani Samiti responsible for O&M	% Villages – VWSC/PO trained to use FTKs	% Villages in which signages about JJM was observed
23%	2%	17%	2%

#### B. Water supply, storage and operation & maintenance at village level (N<sub>v</sub>=94)


Average no. of supply in a day	% Villages levying water service delivery to HH	% Villages having skilled manpower for O&M for PWS	Community monitoring of water wastage in villages
2	82%	32%	22%
% Villages having OHT/ Sump	% Villages having faced O&M challenges	Primary points for reporting grievances	Key problems for reporting grievances
31%	3%	Portal	Pipeline leakage

### 3.9. Perception of HHs on Outcome Indicators

#### a. Health

##### Incidence of water borne diseases at HH level in last one year as reported

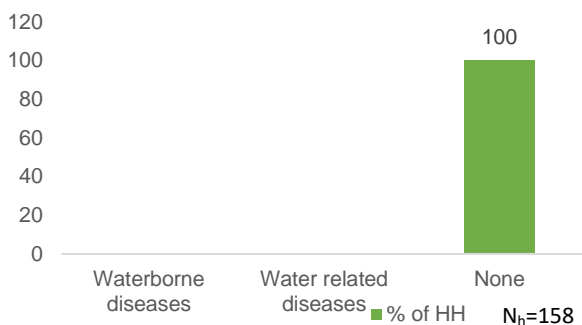
Figure 23: Household reported incidence of water borne diseases in last one year



#### b. Economic Income

##### Change in employment days since FHTC programmes/schemes

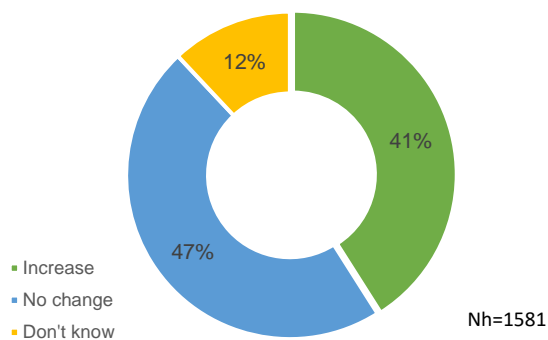
Figure 24: Household reported a change in employment days since FHTC programmes /schemes








#### c. Drudgery
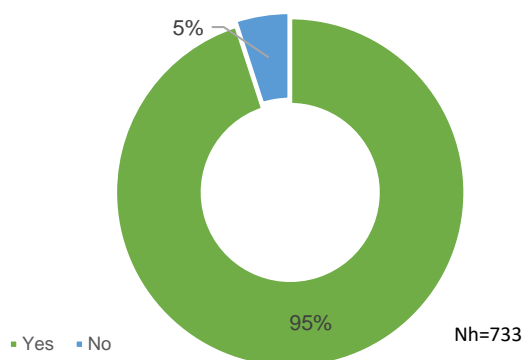
##### Reduction in time and effort in collecting water

Figure 25: Households reported reduction in time and effort in collecting water



### 3.10. User satisfaction

Table No. 5: User satisfaction - more than 75% happy with FHTC services			
S. No.	Parameter (N <sub>h</sub> =1581)		In %
1	Regularity		96
2	Overall quality		95
3	Colour		92
4	Taste		93
5	Odour		91

**Note:**

Base (N<sub>v</sub>)=94 means all villages sampled and covered in South Goa district

Base (N<sub>H</sub>)=1581 means all households sampled and covered across the 94 villages in South Goa district

Base (N<sub>H</sub>)=1581 means all households where female members used to fetch water before HH tap connection



## 4. Annexures

### 4.1. Summary of villages

<b>Table No. 6: Village summary</b>						
<b>S.No.</b>	<b>Name of sample village</b>	<b>Sample HHs</b>	<b>Actual sample HHs (achieved)</b>	<b>No. of scheme</b>	<b>No of source of surface water</b>	<b>No of source of Ground water</b>
1	Total	1530	1674	109	32	28
2	Porteem	9	10	1		1
3	Ugem	9	10	1		
4	Calem	9	10	1		
5	Cotarli	9	10	1		
6	Aglote	9	11	2	1	1
7	Antoriem	9	10	1		
8	Bandoli	18	19	2	1	2
9	Camarconda	18	21	2	2	5
10	Cormonem	18	22	1	2	1
11	Codli	18	19	1	2	1
12	Colem	18	20	2	1	1
13	Darbandora	18	22	3	2	1
14	Molem	18	22	2	2	1
15	Nundem	9	10	1		
16	Piliem	18	19	1	2	1
17	Rivona	9	11	1		
18	Sancordem	27	28	1		
19	Sigao	9	10	1	2	1
20	Surla	9	11	1	2	1
21	Assolda	9	10	0		
22	Xeldem	9	10	1		
23	Cotambi	18	19	1		
24	Zanodem	9	10	1		
25	Molcarnem	9	10	2		
26	Ambaulim	18	19	1		
27	Adnem	9	10	2		1
28	Bali	18	20	3	1	5
29	Fatorpa	18	19	0		
30	Naquerim	9	10	1		
31	Morpila	9	10	1		
32	Bendordem	9	10	1	1	1
33	Avedem	18	19	1		
34	Gaodongrem	27	28	1		
35	Cola	18	19	1		
36	Agonda	18	19	1	1	
37	Shrithal	27	28	1		
38	Poinguinim	18	19	1		1
39	Loliem	27	28	1		1
40	Cotigao	9	10	1		1
41	Verna	27	28	1		
42	Loutulim	27	28	1		
43	Camurlim	27	28	3		
44	Nuven	27	28	1		
45	Calata	18	19	1		
46	Majorda	27	30	1		
47	Utorda	18	19	1		
48	Gonsua	18	19	1		
49	Betalbatim	18	20	1		
50	Colva	18	19	1		

<b>Table No. 6: Village summary</b>						
<b>S.No.</b>	<b>Name of sample village</b>	<b>Sample HHs</b>	<b>Actual sample HHs (achieved)</b>	<b>No. of scheme</b>	<b>No of source of surface water</b>	<b>No of source of Ground water</b>
51	Vanelim	18	19	1		
52	Duncolim	18	19	1	2	
53	Raia	27	28	1		
54	Macasana	18	19	1		1
55	Guirdolim	18	19	1		
56	Curtorim	27	28	1		
57	Cana	27	28	0		
58	Sernabatim	18	19	1		
59	Adsulim	18	19	1	2	
60	Taulim	18	19	1		
61	Dramapur	18	19	1		
62	Dicarpale	18	20	1		
63	Cavorim	18	19	1		
64	Chandor	18	19	1		
65	Mulem	18	19	1		
66	Sirlim	18	19	3		
67	Orlim	18	21	1		
68	Carmona	18	20	1		
69	Deussua	18	19	1		
70	Assolna	18	19	1		
71	Velim	27	29	3		
72	Ambelim	18	19	1		
73	Nagoa	9	10	1		
74	Cavelossim	18	20	2	2	
75	Dabolim	27	30	1		
76	Sao Jacinto Island	9	10	1		
77	Cortalim	18	19	1		
78	Quelossim	18	20	1		
79	Cuelim	18	19	1		
80	Pale		18			
81	Issorcim	9	10	1		
82	Chicolna-Bogmalo	27	28	1		
83	Velsao	18	19	1		
84	Cansaulim	18	19	1	1	
85	Arossim	18	23	1		
86	Aquem	9	10	1		
87	Benaulim	18	19	2	2	
88	Sancoale	9	10	1	1	
89	St Jose De Areal	9	10	1		
90	Sanvordem	9	11	1		
91	Varca	9	10	1		
92	Navelim	9	10	1		
93	Chicalim	9	10	1		
94	Davorlim	9	10	1		
95	Chinchinim	9	10	1		

## 4.2. Functionality – 55 LPCD vs regularity vs potability vs working tap connection

Table No. 7: Functionality of HH tap connection						
S. No.	Village	Fully Functional* (% HH)	Adequate Quantity (% HH)	Fully Regular Supply (% HH)	Potable (Quality) (% HH)	Working tap connections (%HH)
1	Total	81.2	96.3	95.5	88.7	100.0
2	Porteem	0.0	100.0	100.0	0.0	100.0
3	Ugem	100.0	100.0	100.0	100.0	100.0
4	Calem	77.8	88.9	100.0	88.9	100.0
5	Cotarli	100.0	100.0	100.0	100.0	100.0
6	Aglote	50.0	100.0	50.0	100.0	100.0
7	Antoriem	88.9	88.9	100.0	100.0	100.0
8	Bandoli	94.4	100.0	100.0	94.4	100.0
9	Camarconda	90.0	100.0	90.0	100.0	100.0
10	Cormonem	81.0	100.0	81.0	100.0	100.0
11	Codli	94.4	100.0	100.0	94.4	100.0
12	Colem	10.5	100.0	100.0	10.5	100.0
13	Darbandora	66.7	100.0	66.7	100.0	100.0
14	Molem	81.0	100.0	100.0	81.0	100.0
15	Nundem	100.0	100.0	100.0	100.0	100.0
16	Piliem	77.8	100.0	94.4	83.3	100.0
17	Rivona	0.0	0.0	100.0	90.0	100.0
18	Sancordem	40.7	88.9	51.9	96.3	100.0
19	Sigao	22.2	33.3	88.9	100.0	100.0
20	Surla	100.0	100.0	100.0	100.0	100.0
21	Assolda	100.0	100.0	100.0	100.0	100.0
22	Xeldem	88.9	100.0	100.0	88.9	100.0
23	Cotambi	88.9	100.0	88.9	100.0	100.0
24	Zanodem	100.0	100.0	100.0	100.0	100.0
25	Molcarnem	100.0	100.0	100.0	100.0	100.0
26	Ambaulim	94.4	100.0	100.0	94.4	100.0
27	Adnem	100.0	100.0	100.0	100.0	100.0
28	Bali	100.0	100.0	100.0	100.0	100.0
29	Fatorpa	100.0	100.0	100.0	100.0	100.0
30	Naquerim	100.0	100.0	100.0	100.0	100.0
31	Morpila	88.9	88.9	100.0	100.0	100.0
32	Bendordem	0.0	33.3	11.1	100.0	100.0
33	Avedem	27.8	27.8	100.0	100.0	100.0
34	Gaodongrem	100.0	100.0	100.0	100.0	100.0
35	Cola	100.0	100.0	100.0	100.0	100.0
36	Agonda	100.0	100.0	100.0	100.0	100.0
37	Shristhal	100.0	100.0	100.0	100.0	100.0
38	Poinguinim	100.0	100.0	100.0	100.0	100.0
39	Lolliem	100.0	100.0	100.0	100.0	100.0
40	Cotigao	100.0	100.0	100.0	100.0	100.0
41	Verna	100.0	100.0	100.0	100.0	100.0
42	Loutulim	96.3	96.3	100.0	100.0	100.0
43	Camurlim	100.0	100.0	100.0	100.0	100.0
44	Nuvem	100.0	100.0	100.0	100.0	100.0
45	Calata	100.0	100.0	100.0	100.0	100.0
46	Majorda	72.4	100.0	100.0	72.4	100.0
47	Utorda	100.0	100.0	100.0	100.0	100.0
48	Gonsua	94.4	94.4	100.0	100.0	100.0
49	Betalbatim	94.7	100.0	100.0	94.7	100.0
50	Colva	94.4	100.0	100.0	94.4	100.0
51	Vanelim	94.4	94.4	100.0	100.0	100.0
52	Duncolim	66.7	77.8	77.8	100.0	100.0
53	Raia	25.9	100.0	100.0	25.9	100.0
54	Macasana	94.4	100.0	100.0	94.4	100.0

<b>Table No. 7: Functionality of HH tap connection</b>						
<b>S. No.</b>	<b>Village</b>	<b>Fully Functional* (% HH)</b>	<b>Adequate Quantity (% HH)</b>	<b>Fully Regular Supply (% HH)</b>	<b>Potable (Quality) (% HH)</b>	<b>Working tap connections (%HH)</b>
55	Guirdolim	100.0	100.0	100.0	100.0	100.0
56	Curtorim	0.0	100.0	100.0	0.0	100.0
57	Cana	96.3	100.0	100.0	96.3	100.0
58	Sernabatim	94.4	100.0	100.0	94.4	100.0
59	Adsulim	61.1	94.4	66.7	94.4	100.0
60	Talaulim	94.4	94.4	100.0	100.0	100.0
61	Dramapur	72.2	100.0	100.0	72.2	100.0
62	Dicarpale	100.0	100.0	100.0	100.0	100.0
63	Cavorim	0.0	100.0	94.4	0.0	100.0
64	Chandor	0.0	100.0	100.0	0.0	100.0
65	Mulem	100.0	100.0	100.0	100.0	100.0
66	Sirlim	100.0	100.0	100.0	100.0	100.0
67	Orlim	95.0	100.0	100.0	95.0	100.0
68	Carmona	100.0	100.0	100.0	100.0	100.0
69	Deussua	83.3	100.0	83.3	100.0	100.0
70	Assolna	100.0	100.0	100.0	100.0	100.0
71	Velim	32.1	100.0	100.0	32.1	100.0
72	Ambelim	100.0	100.0	100.0	100.0	100.0
73	Nagoa	88.9	100.0	100.0	88.9	100.0
74	Cavelossim	68.4	100.0	68.4	100.0	100.0
75	Dabolim	100.0	100.0	100.0	100.0	100.0
76	Sao Jacinto Island	88.9	100.0	100.0	88.9	100.0
77	Cortalim	100.0	100.0	100.0	100.0	100.0
78	Quelossim	94.7	100.0	100.0	94.7	100.0
79	Cuelim	100.0	100.0	100.0	100.0	100.0
80	Pale	100.0	100.0	100.0	100.0	100.0
81	Issorcim	100.0	100.0	100.0	100.0	100.0
82	Chicolna-Bogmalo	100.0	100.0	100.0	100.0	100.0
83	Velsao	100.0	100.0	100.0	100.0	100.0
84	Cansaulim	100.0	100.0	100.0	100.0	100.0
85	Arossim	100.0	100.0	100.0	100.0	100.0
86	Aquem	100.0	100.0	100.0	100.0	100.0
87	Benaulim	55.6	100.0	55.6	100.0	100.0
88	Sancoale	100.0	100.0	100.0	100.0	100.0
89	St Jose De Areal	0.0	100.0	100.0	0.0	100.0
90	Sanvordem	20.0	20.0	100.0	100.0	100.0
91	Varca	88.9	100.0	100.0	88.9	100.0
92	Navelim	100.0	100.0	100.0	100.0	100.0
93	Chicalim	100.0	100.0	100.0	100.0	100.0
94	Davorlim	77.8	100.0	100.0	77.8	100.0
95	Chinchinim	77.8	100.0	100.0	77.8	100.0

\* Fully Functional has been computed as = Adequate Quantity  $\cap$  Fully Regularity Supply  $\cap$  Potable (Quality)

## 4.3. Villages not meeting the quality parameters

Table No. 8: Quality parameters dissatisfied at village level						
1. pH (Acceptable Range- 6.5 to 8.5)						
S.No.	Block Name	Panchayat Name	Villages	No. of HHs outside the acceptable range		
1	Dharbandora	Colem	Colem	17		
2		Molem	Molem	4		
3	Mormugao	Majorda-Utorda-Calata	Majorda	8		
4	Quepem	Ambaulim	Ambaulim	1		
5	Salcete	Chandor-Cavorim	Cavorim	18		
6			Chandor	18		
7		Chinchinim-Deusa	Chinchinim	2		
8		Curtorim	Curtorim	27		
9		Dramapur-Sirlim	Dramapur	5		
10		Macazana	Macasana	1		
11		Orlim	Orlim	1		
12		Raia	Raia	20		
13		Rumdamol-Davorlim	Davorlim	2		
14		St. Jose-De-Areal	St Jose De Areal	9		
15		Velim	Velim	19		
16	Sanguem	Curdi-Vadem	Porteem	9		
17		Rivona	Rivona	1		
2. Free residual chlorine (Acceptable Range- 0.2 to 1 PPM)						
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permisible range	HHs with no chlorine	
1	Canacona	Agonda	Agonda	0	16	
2		Cola	Cola	0	3	
3		Cotigao	Cotigao	0	9	
4		Gaondongrim	Gaodongrem	0	26	
5		Loliem	Loliem	0	20	
6		Shristhal	Shristhal	0	9	
7			Sigao	0	9	
8		Darbandora	Darbandora	0	3	
9			Piliem	0	10	
10			Camarconda	0	1	
11			Cormonem	0	3	
12			Codli	0	1	
13		Molem	Molem	0	1	
14			Sancordem	0	9	
15			Surla	0	1	
16		Mormugao	Cansaulim-Arossim-Cuelim	Cuelim	0	18
17				Cansaulim	0	18
18				Arossim	0	18
19			Chicalim	Dabolim	0	29
20				Sao Jacinto Island	0	3
21	Chicolna-Bogmalo		Chicolna-Bogmalo	0	27	
22			Majorda	0	28	
23			Utorda	0	18	
24	Sancoale		Sancoale	0	8	
25	Velsao-Pale-Issorcim		Pale	0	3	
26			Velsao	0	2	
27	Verna		Verna	0	4	
28	Salcete	Balli-Adnem	Adnem	0	1	
29		Morpila	Morpila	0	9	
30		Ambelim	Ambelim	0	17	
31			Gonsua	0	16	
32			Betalbatim	0	19	
33		Camurlim	Camurlim	0	16	
34		Cana-Benaulim	Cana	0	27	
35			Adsulim	0	18	
36			Benaulim	0	1	

Table No. 8: Quality parameters dissatisfied at village level					
37			Chinchinim	0	7
38			Vanelim	0	4
39		Dramapur-Sirlim	Dramapur	0	17
40			Sirlim	0	18
41		Guirdolim	Guirdolim	0	3
42		Loutolim	Loutulim	0	20
43		Macazana	Macasana	0	1
44		Nuven	Nuven	0	24
45		Seraulim	Duncolim	0	18
46		Velim	Velim	0	8
47		Curdi-Vadem	Porteem	0	9
48		Netorli	Nundem	0	5
49		Rivona	Rivona	0	1
50		Sanvordem	Antorim	0	9
51			Sanvordem	0	1
3. Turbidity (Acceptable Range- 1 to 5 NTU)					
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range	
1	Dharbandora	Darbandora	Piliem	3	
2	Mormugao	Kirlapal-Dabal	Codli	1	
3		Nagoa	Nagoa	1	
4		Quelossim	Quelossim	1	
5	Salcete	Betalbatim	Betalbatim	1	
6		Colva-Sernabatim-Gandaulim-Vaneli	Sernabatim	1	
7		Raia	Raia	1	
8		Varca	Varca	1	
9		Velim	Velim	1	
10	Sanguem	Calem	Calem	1	
4. Total hardness (Acceptable Range- 200 to 600 Milligram/litre)					
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range	
NA	NA	NA	NA	NA	
5. Total alkalinity (Acceptable Range- 200 to 600 Milligram/litre)					
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range	
NA	NA	NA	NA	NA	
6. Chloride (Acceptable Range- 250 to 1000 Milligram/litre)					
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range	
NA	NA	NA	NA	NA	
7. Ammonia (Acceptable Range- 0.5 Milligram/litre)					
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range	
NA	NA	NA	NA	NA	
8. Iron (Acceptable Range- 1 Milligram/litre)					
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range	
NA	NA	NA	NA	NA	
9. Nitrate (Acceptable Range- 1 Milligram/litre)					
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range	
NA	NA	NA	NA	NA	
10. Sulphate (Acceptable Range- 200 to 400 Milligram/litre)					
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range	
NA	NA	NA	NA	NA	
11. Total dissolved solids (Acceptable Range- 500 to 2000 Milligram/litre)					
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range	
NA	NA	NA	NA	NA	
12. Bacteriological test (Presence)					

Table No. 8: Quality parameters dissatisfied at village level				
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range
1	Dharbandora	Kirlapal-Dabal	Bandoli	1
2		Sacordem	Sancordem	1
3	Mormugao	Chicalim	Sao Jacinto Island	1
4	Quepem	Xeldem	Xeldem	1
5	Salcete	Cana-Benaulim	Cana	1
6			Adsulim	1
7		Colva-Sernabatim-Gandaulim-Vaneli	Colva	1
13. Fluoride (Acceptable Range- 1 to 1.5 Milligram /litre)				
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range
NA	NA	NA	NA	NA
14. Arsenic (in hotspots) (Acceptable Range- 0.01 Milligram /litre)				
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range
NA	NA	NA	NA	NA