

Functionality Assessment of Household Tap Connection under National Jal Jeevan Mission - 2022



District Report: Tiruvallur, Tamil Nadu Survey Duration: March to April 2022

## Contents

Abb	revia	itions	3
Glos	sary	۲	4
1.	Fac	tsheet	6
2.	Cor	ntext	8
2.1.	D	District snapshot:	8
2.2.	F	HTC Assessment Objectives	9
2.3.	A	ssessment Methodology	9
2.4.	S	ample Size	9
2.5.	S	ampling Methodology1	0
2.6.	N	Aethodology for Water Quantity Measurement at Households1	1
2.7.	N	Aethodology for Water Quality Measurement1	1
2.8.	Ρ	Project implementation1	2
2.9.	S	ample coverage1	3
2.10		Sampled village and household profile1	3
3.	Find	Jings1	4
3.1.	F	unctionality status of FHTC at household level1	4
3.2.	G	Quantity, Regularity, and Quality of Water1	5
3.3.	/	Average water supply days in a week1	8
3.4.	F	lousehold utilization of water for drinking and other activities1	8
3.5.	S	tatus at HH level (Nh=)1	8
3.6.	S	Source sustainability at the village level1	9
3.7.	V	Vater quality monitoring and surveillance in the villages2	0
3.8.	S	tatus of JJM2	0
3.9.	Ρ	Perception of HHs on Outcome Indicators2	1
3.10		User satisfaction2	2
4.	Ann	exures2	3
4.	1.	Summary of villages2	3
4.	2.	Functionality – 55 LPCD vs regularity vs potability vs working tap connection2	3
4.	3.	Villages not meeting the quality parameters2	4



# Abbreviations

AWC	Aanganwadi Centre
FHTC	Functional Household Tap Connection
Gol	Government of India
GP	Gram Panchayat
HF	Health Facility
HH	Household
HGJ	Har Ghar Jal
JJM	Jal Jeevan Mission
LPCD	Litres per Capita per Day
MVS	Multi-village Scheme
NJJM	National Jal Jeevan Mission
RC	Residual Chlorine
O&M	Operation and Maintenance
OHT	Over Head Tank
PSU	Primary Sampling Unit
PWS	Piped Water Supply
SVS	Single Village Scheme
VAP	Village Action Plan
VWSC	Village Water and Sanitation Committee
WQMIS	Water Quality Monitoring and Information System



# Glossary

- 1. Community Group of people living in one particular area or village/habitation
- Cross-sectional research A cross-sectional study is a type of research design in which data is collected from a relatively large and diverse group of people at a single point in time
- 3. **Drinking water source** Groundwater (open well, borewell, tube well, handpump, spring, etc.)/ surface water (river, lake, pond, reservoir, etc.)/rainwater, available for drinking and domestic use
- 4. Improved sources The following sources as considered improved by the National Family Health Survey definitions: Piped water into dwelling, yard/plot with a tap, piped water connected to public stand-posts, tube well or borewell, Hand pump, dug well– protected, Spring–protected, Rainwater, Water ATM/ Community RO plant/ Community Water Purification Plant (CWPP)
- 5. **Unimproved sources** The following sources as considered unimproved by the National Family Health Survey definitions: Unprotected spring, unprotected dug well, cart with small tank / drum, Tanker/ truck, Surface water (river/ dam/ lake/ pond/ canal), and bottled water
- 6. **Functional Household Tap Connection (FHTC)** A tap connection to a rural household for providing drinking water in adequate quantity of prescribed quality on regular basis.
- 7. **Functionality of FHTC** Functionality of a tap connection is defined as having infrastructure, i.e., household tap connection providing water in adequate quantity, as presented:

Definitions	Fully-functional	Partially-functional	Non-functional
Quantity	>= 55 LPCD	> 40 LPCD - < 55 LPCD	< 40 LPCD
Regularity	12 months or daily basis	9-12 months or < daily basis	< 9 months or < daily basis
Quality	Potable	Potable	Non potable

- 8. **Quantity (in litres)** of water received by households per person per day should meet the service level of 55 LPCD
- 9. **Functionality Assessment** An assessment of the functionality of rural household tap connections based on a sample survey
- 10. **Fully Regular –** Regularity of water is considered when a rural household receives water for 12 months on daily basis or as per schedule.
- 11. **Potability –** Potable water is water that is safe to be used as drinking water. Parameters of potable water are mentioned below:

Parameters for potable water tested in the survey				Permissible Limit in the absence of alternative sources
i.	pH (tested on site)	-	6.5 to 8.5	No relaxation
ii.	Free residual chlorine (tested on site)	Mg/litre	0.2	1
iii.	Turbidity	NTU	1	5
iv.	Total hardness	Mg/litre	200	600
٧.	Total alkalinity	Mg/litre	200	600
vi.	Chloride	Mg/litre	250	1000
vii.	Ammonia	Mg/litre	0.5	No relaxation
viii.	Phosphate	Mg/litre	0.3	1
ix.	Iron (in hotspots only)	Mg/litre	1	No relaxation
х.	Nitrate	Mg/litre	45	No relaxation
xi.	Sulphate	Mg/litre	200	400
xii.	Total dissolved solids	Mg/litre	500	2000



Parameters for potable water tested in the survey		Unit	Acceptable Limit	Permissible Limit in the absence of alternative sources	
xiii.	Fluoride	Mg/litre	e 1		
xiv.	Arsenic (in hotspots only)	Mg/litre	0.01	No relaxation	
<ul> <li>xv. Bacteriological test for Total coliform bacteria and E. coli or thermotolerant coliform bacteria</li> </ul>		Shall not be detectable in	any 100 ml sample		

- 12. **Sampling** Selection of a subset of individuals from within a statistical population to estimate water service delivery among the population. In the current study, households have been sampled to estimate the representation of the village and subsequently of the district as well as of the state.
- 13. Types of schemes: Following are the piped water supply schemes that were assessed
  - a. Mini-solar based piped water supply scheme in isolated/tribal hamlets
  - b. Single Village Scheme (SVS) in villages having adequate groundwater that needs treatment
  - c. Single village scheme (having adequate groundwater/ spring water/ local or surface water source of prescribed Quality)
  - Retrofitting of ongoing schemes taken up under erstwhile NRDWP for the last mile connectivity/ retrofitting of completed rural water supply schemes to make it JJM compliant
  - e. Multi-village PWS scheme with water grids/ regional water supply schemes
- 14. Village Action Plan (VAP) Plan prepared by Gram Panchayat and/ or its sub-committee, i.e., VWSC/ Paani Samiti/ User Group, etc. based on baseline survey, resource mapping and felt needs of the village community to provide FHTC to every rural household, treat the generated greywater and plan its reuse, undertake surveillance activities, etc. VAP also indicates the fund requirement and timelines for completion of work under the Mission and will be approved by the Gram Sabha. Irrespective of the source of funding, all drinking water-related works in the village are taken up based on the VAP.
- 15. **Source Sustainability** includes measures such as aquifer recharge, rainwater harvesting, increased storage capacity of water bodies, reservoirs, de-silting, etc. improve the lifespan of water supply systems
- 16. Har Ghar Jal (HGJ) An administrative unit wherein all HHs are provided with water supply through FHTCs is called "Har Ghar Jal".
- 17. **Public Institutions** The public institutions in the survey include Aanganwadi Centre (AWC), Health Facilities, Schools, Gram Panchayat, and government buildings.
- 18. Working tap connection A tap connection supplied water at least one day in the week, preceding of survey
- 19. **Functional Scheme –** A scheme is said to be functional if it was reported to be working for all 12 months in a year.



# 1. Factsheet

Indicators	State	District
Functionality status of FHTC at households		
Households (HHs) which received water through FHTC at least once in last 7 days (%)	100	100
Fully functional (%)	86	95
Partially functional (%)	11	5
Non-functional (%)	3	0
Quantity of water received by households		
Adequate quantity (>55 LPCD) (%)	100	100
Partially adequate quantity (> 40 LPCD - < 55 LPCD) (%)	3	0
Inadequate quantity (<40 LPCD) (%)	3	0
Regularity of water received by households		
Fully Regular Supply (as per schedule) (%)	93	100
Partially Regular Supply (not as per schedule) (%)	5	0
Irregular Supply (less than 9 months' supply) (%)	2	0
Potable (Quality) water received by households		
Potable (%)	97	95
Non-potable (%)	3	5
Residual Chlorine (RCL) detected with in permissible limits (%)	32	44
Household loval indicators		

74	100
95	99
84	95
52	62
53	39
36	48
93	100
0	0
78	92
95	99
91	94
	95 84 52 53 36 93 0 78 95




Indicators	State	District
Village level indicators (based on village questionnaire)		
Schemes reported to be functional (%)	40	87
Villages with groundwater resource (%)	65	82
Villages having groundwater recharge structure <sup>1</sup> (%)	13	36
Water supply and storage status in villages		
Average no. of times water is supplied in a day	1	2
Villages having OHT/ Sump for storage of water (%)	98	100
Water quality monitoring and surveillance in the villages		
Villages with Field Test Kits (%)	73	91
Villages in which bacteriological test was done in last 1 year by VWSC/ Pani Samiti (%)	31	55
Villages reported to have a mechanism for chlorination (%)	72	91
VWSC/Pani Samiti and PWS signage in villages		
Village reported having presence of VWSC/ Pani Samiti (%)	41	73
Villages in which VWSC/ Pani Samiti is responsible for Operation & Maintenance of PWS schemes (%)	13	36
Villages in which persons are trained to use Field Test Kits (%)	62	73
Villages in which signages about JJM were observed (%)	11	9
Operation and maintenance at village		
Villages levying water service delivery to households (%)	63	55
Convergence of JJM activities with other schemes in the villages (%)	8	9
Villages having skilled manpower for Operation & Maintenance of PWS schemes (%)	48	36
Community monitoring of water wastage in villages (%)	32	36

 $<sup>^{1}</sup>$  Out of villages who reported to have groundwater source (N\_v=9)

# 2. Context

Jal Jeevan Mission (JJM) was launched on the 15th of August 2019 with the objective to provide functional household tap connections (FHTCs) to all rural households.

Figure 1: Har Ghar Jal - Objective, Vision, & Outcome

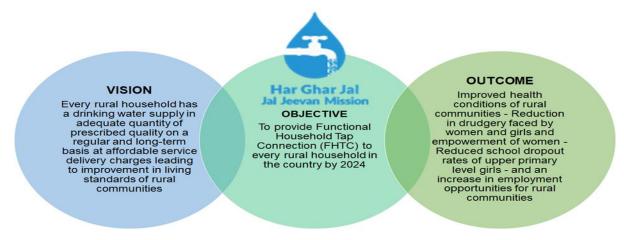

In accordance with the overall objectives as specified in the Operational Guidelines for the implementation of the NJJM, Gol carried out a sample survey to assess the functionality of household tap connections. As part of this endeavour, NJJM, Gol engaged HTA Kantar Public to conduct the 'Functionality Assessment' of the household as well as public institution/ buildings such as schools, anganwadis, gram panchayat buildings, public health facilities, and wellness centers in all the rural districts for the fiscal year 2021-22.

## 2.1. District snapshot: Tiruvallur

District Tiruvallur of Tamil Nadu has a population of 2109010. The district has 8 blocks. Out of 526 villages in the district, 221 are SC dominated and 2 are ST dominated villages. The district lies in East Coast Plains and Hills Region and receives an annual rainfall of 1103.9mm.

Presented here are district level information collated from the DDWS-IMIS:

Figure 2: District IMIS Status & Map

#### IMIS status:

- 13 (2% of all) villages are Har Ghar Jal
- 513 (98% of all) villages are Non-Har ghar Jal
- SC/ST dominated district
- Non JE/AES
- No- History of water contamination
- 463 (88% of all) villages with PWS more than 20 FHT(





# 2.2. FHTC Assessment Objectives


Figure 3: Objectives of Functionality of Tap Connections



## 2.3. Assessment Methodology

A cross-section research design has been used for this functionality assessment study. Quantitative data were collected from villages and households across all states/UTs using the CAPI (Computer Assisted Personal Interviewing) mode. The survey includes two components, village, and household.

Figure 4: Survey Components & Respondents

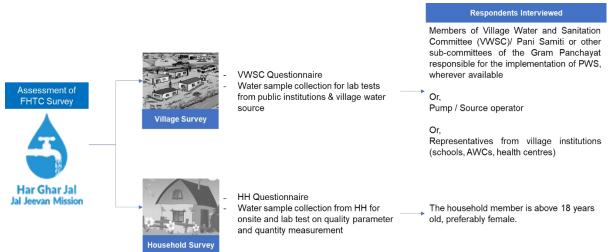

# 2.4. Sample Size

The sample size was calculated to provide estimates with a 95% confidence interval (CI) and 5% margin of error (MoE) after incorporating the correction factor for a finite population considering the total number of geographic units having FHTCs.

- Village sample is estimated to be representative at the state level
- HH sample estimated to be representative at the district level



- Number of Har Ghar Jal (HGJ) villages were proportionately sampled at the district level
- All PWS schemes (up to 4) were covered per village. Per scheme approximately 9 (3 each from the head, middle, and tail HHs) or 18 households (6 each from head, middle, and tail HHs) were sampled to achieve the desired sample at the district level.

## 2.5. Sampling Methodology

As per the design, all villages having a PWS scheme with 20 or more functional household tap connections were included in the sample frame. The probability proportionate to size (PPS) method was used for village selection in each district. The steps for random selection of villages using PPS are as presented:

Figure 5: Steps for Village Sampling



The key considerations for the village and household sampling were:

Figure 6: Sampling Considerations – Village & Households



The record of all district-wise village replacements is maintained and reported as part of the annexure.

# 2.6. Methodology for Water Quantity Measurement at Households

Figure 7: Steps for Measuring Flowrate from Supply-tap at HHs



The flow rate of the water supply was measured using a container with gradual markings (either 5 litres or 1 litre, based on the flow of the tap) and a stopwatch/timer-watch. The process followed is as described in Figure 7.

In the case of households where the FHTC is connected directly with the storage tank, the following steps were adopted to measure the quantity:

- Assessor first asked and recorded length, breadth, and height.
- Assessor dipped a 5 feet long rod, marked the level of the water table, and calculated the volume – length x breadth x-height of water.
- Next the assessor opened the valve of the connection and allowed the water to flow inside the storage for 10 minutes.
- After 10 mins, the valve was closed, and the assessor again dipped the rod and recorded the new height of the water inside the tank. Based on this new 'height' and the CAPI calculated the changed volume.
- The difference in the volume of water in 10 minutes divided by 10 provided the flow rate of the water supply per minute.


The water flow rate was not measured for village-level public institutions.

#### 2.7. Methodology for Water Quality Measurement

Water quality was tested for all public institutions available in the villages, including schools, anganwadis, gram panchayat buildings, public health facilities, and wellness centers, and at the selected households. Two types of quality tests were carried out – a) spot test for pH and free residual chlorine, and b) water sample was collected and transported to labs for testing against 13 quality parameters (total 15) as specified in Figure 8.



#### Figure 8: On-site & Laboratory Based Quality Test

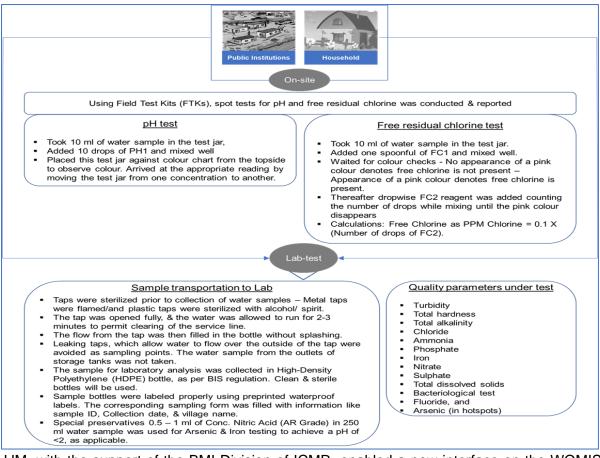


JJM, with the support of the BMI Division of ICMR, enabled a new interface on the WQMIS portal for "Functionality Assessment (FA) User" to enable seamless harmonization of water sample registration, sample submission for testing, and sharing of results as per the applicable quality parameters.

## 2.8. Project implementation

An overview of the project implementation is as presented:

Figure 9: Broad project implementation framework

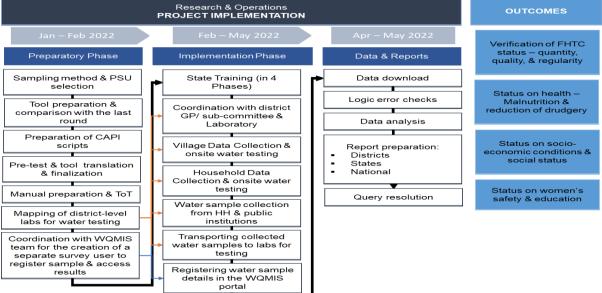

A total of 6 teams (comprising 6 supervisors, 72 assessors, and 6 water collection assistants) were recruited, trained, and deployed to complete the survey across the states of Tamil Nadu. One survey team covered approximately 2 - 3 districts. The state-wise team deployment and fieldwork dates were as presented:

Table No. 1:	State-wise tear	n deployment ar	nd data collectio	n start & end da	tes
State		Teams deployed	Start date	End date	Total data collection days
Tamil Nadu		6 Teams	3/9/2022	4/7/2022	30 days

A four-tier quality control (QC) system was put in place. At the ground level, the data collection exercise was done using a computer-aided Personal Interview (CAPI) application which contained all logic and skip-checks inbuilt. Also, 5% of the total samples were accompanied by the supervisors. Sub-targeted QC was done by the state field managers (5%) and the central project management team (5%). Apart from this, the central research team monitored the data trend and as per requirement debriefed data collection teams to improve quality.

## 2.9. Sample coverage

Table No. 2:	Sample covered				
	Targetee	d sample		Achieved sam	ple
District	Village	НН	Village	НН	Public Institutions
Tiruvallur	11	396	11	398	18
Tamil Nadu	413	13,887	413	13,922	987

# 2.10. Sampled village and household profile

SAMPLED VILLAGES	SAMPLED HOUSEHOLDS
Total no. of villages covered in the district – 11	Total no. of households covered in the district
Percentage of SC dominated villages covered	- 398
in the district is % (which is slightly higher than	• Proportion of General - 43%, SC 38%, ST% 2,
the state average, i.e., 24%)	OBC 17% households
Percentage of ST dominated villages covered	• 28% of the FHTC connections are under the
in the district is None (which is lower than the	name of a female member
state average, i.e., 1%)	<ul> <li>Average household size – 4</li> </ul>
Higher proportion of vwsc/pani samiti\pump	<ul> <li>&gt;75% positive user experience in 5/5</li> </ul>
operator interviewed at the village level	measures
No the district reported to have any historical	
incidence of water contamination	



# 3. Findings

# 3.1. Functionality status of FHTC at household level **A. Overall Functionality\* (in %)**



Figure 10: Functionality of HH tap connection

It has been found that 100 percent of the sampled HHs (N=398) had working tap connections (i.e., received water at least once in last 7 days). More than nine out of ten (95 percent) HHs had fully functional tap connection (i.e., HHs receiving adequate quantity of prescribed quality of water on a regular basis).




## 3.2. Quantity, Regularity, and Quality of Water

Under JJM, functionality is defined as having infrastructure, i.e., household tap connection providing water in adequate quantity (55 LPCD or more) of prescribed quality on regular basis (every day or as decided by GP and/ or its sub-committee) with adequate pressure. It will also include long-term source and system sustainability. Presented here are the findings in this respect.

#### A. Water quantity measured as LPCD (Litres per Capita per Day)


**100% HHs** reported receiving adequate quantity of water

Figure 11: Quantity of water received by households

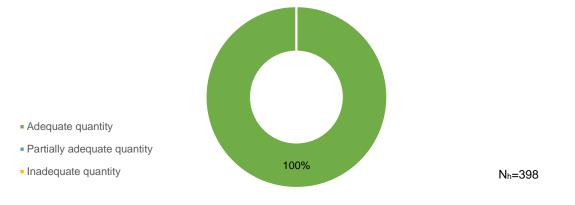


#### Quantity of water received across head, middle, and tail end HHs

Figure 12: Quantity of water received across head, middle and tail end households

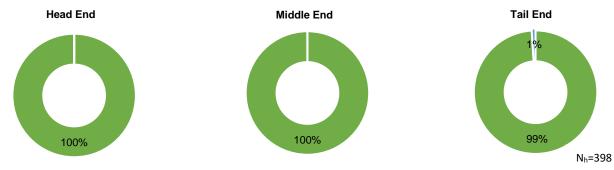


#### B. Regularity of water supply to households

**100% HHs** receive a regular supply of water (as per agreed schedule) *Figure: Regularity of water received by households* 

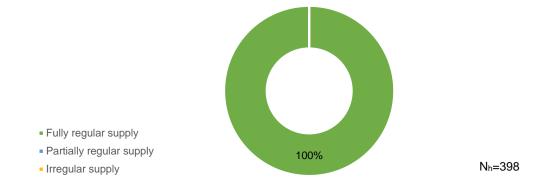



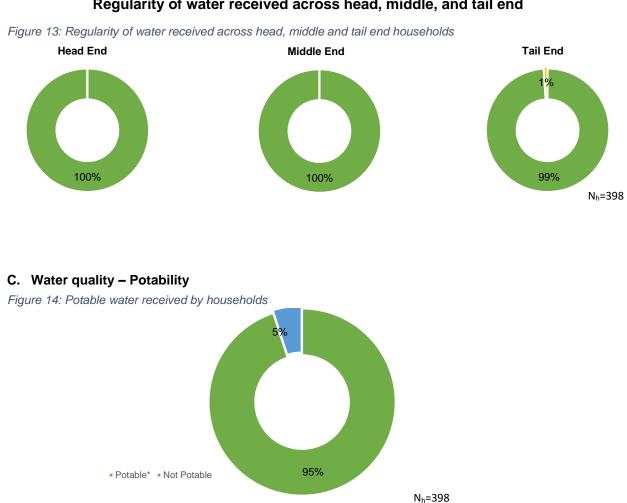

\*Potable water has been considered basis testing of water samples through laboratory tests for physical, chemical, and bacteriological as given in Table 4 parameters (within acceptable/permissible range) and onsite testing of pH. The details of laboratory test are mentioned in the table given above in the glossary.

Table No. 3:	Village quality parameters reported within permissible range (% sample within
permissibl	e range)

Quality Parameters (N <sub>v</sub> =32)	Water	Samples Tested	I from Public Ins	stitutes
	Anganwadi Centre	Health Facility	Anganwadi Centre	Others
pH (on-site)	100	100	100	100
Turbidity	100	100	100	100
Total Hardness	0	100	50	50
Total Alkalinity	100	100	100	100
Chloride	100	100 100 100		100
Ammonia		Not to	ested	
Iron		No h	istory	
Nitrate	100	100	100	100
Sulphate	100	100	100	100
Total Dissolved Solids	0	100	50	50
Bacteriological Test (Absence)	Not tested			
Fluoride		No h	istory	
Arsenic	No history			



KANTAR PUBLIC HTA

Quality Parameters	No of samples tested	% Households	
pH (on-site)	398	100	
Turbidity	314	100	
Total Hardness	314	94	
Total Alkalinity	314	100	
Chloride	314	100	
Ammonia	Not tested		
Iron	No hist	ory	
Nitrate	314	100	
Sulphate	314	100	
Total Dissolved Solids	314	100	
Bacteriological Test (Absence)	314	100	
Fluoride	No hist	ory	
Arsenic	No history		

# Table No. 4: Household water quality parameters reported within permissible range in % sample within permissible range)

#### Safeguarding piped water supply for unforeseen bacteriological contamination-Presence of Residual Chlorine (RC)

The Residual Chlorine (RC) in the Tiruvallur district was found in 44% samples. Out of which 16% samples were having RC outside range whereas 40% samples, had no RC. It may be mentioned that 100% of water samples passed the bacteriological contamination test but to assure the protection against bacteriological contamination, addition of RC is must in PWS system.

The Residual Chlorine in piped water supply is one of the most important preventive actions to assure quality of water against bacteriological contamination from source to consumption. The presence of residual chlorine within permissible limits is indicator of well-maintained and healthy piped water supply system.

It is advised that behavioural change communication campaigns on appropriate dosage of residual chlorine is held in all villages and monitoring system for chlorine dosing is established. The FTK must have residual chlorine testing facility for effective WQM&S.

#### Comment on functioning of District Lab:


The district lab tested water samples for 8 water quality parameters. 416 water samples were submitted, and 332 water samples were tested, and reports made available. The turnaround time for testing was more than 48 hours in most cases.

The labs did not have any issue with testing the number of water samples submitted nor had any issues with human resource, reagents etc.




#### 3.3. Average water supply days in a week

Figure 15: Average number of days households receive water supply in a week (in %)

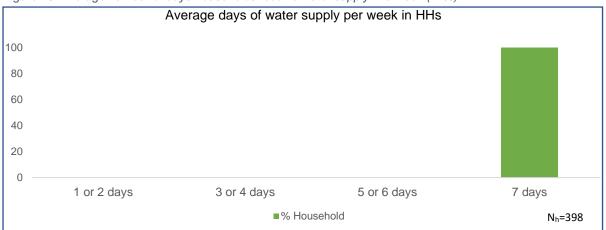


# 3.4. Household utilization of water for drinking and other activities

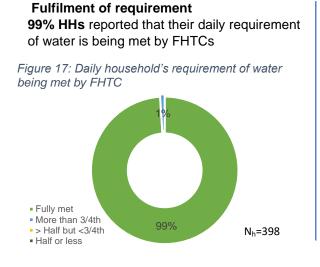


# 3.5. Status at HH level (Nh=398)

#### Primary source of drinking water 95% HHs reported HH tap connection as their primary source of drinking water

Figure 18: Households reported FHTC as primary source of drinking water

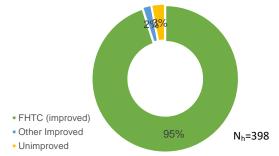

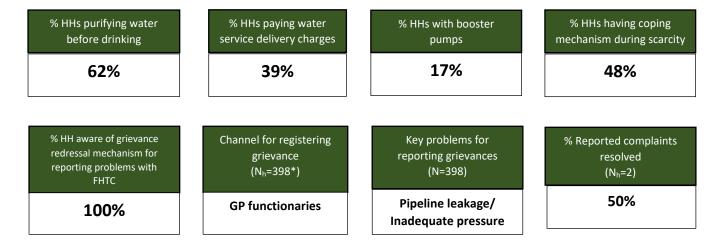


\*HHs who reported complaints in last 1 year

#### 3.6. Source sustainability at the village level

#### Schemes based on surface and ground water

#### 62% of schemes are reported to be based on ground water.

Figure 19: Schemes based on water source in village

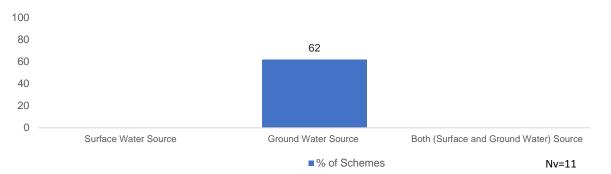


\*'Surface Water Source' is Stream, Spring, Glacier, River, lake, pond etc. and Groundwater Source is open well, borewell, tube well, handpump, spring, etc

#### Villages reported having presence of a groundwater source


36% of villages reported the presence of groundwater sources like improved dug wells and borewells, and % were supported by recharging structures.

Figure 20: Villages reported the presence of groundwater sources and among those how many reported to have a recharge structure

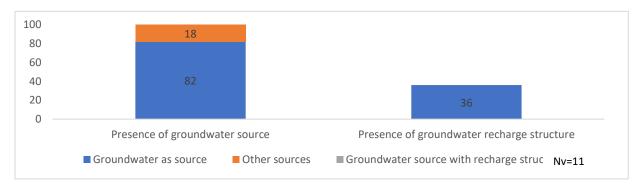

#### The top 3 other source sustainability measure taken by villages


Figure 21: Villages reported having taken other source sustainability measure

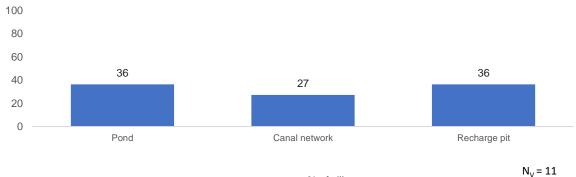

% of villages

# 3.7. Water quality monitoring and surveillance in the villages

Figure 22: Water quality monitoring and surveillance by villages

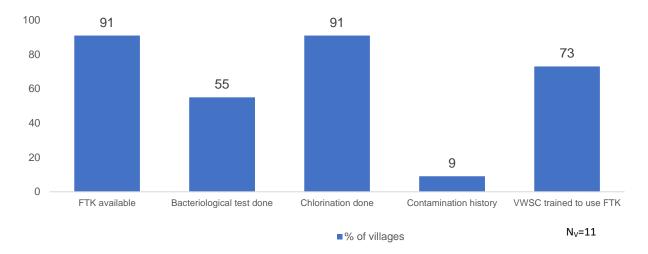


## 3.8. Status of JJM

# A. VWSC/Pani Samiti and PWS signage in villages (Nv=11)

73%	PWS Schemes	73%	observed 9%	
Presence of VWSC/Pani Samiti	VWSC/Pani Samiti responsible for O&M of	% Villages – VWSC/PO trained to use FTKs	% Villages in which signages about JJM was	

## B. Water supply, storage and operation & maintenance at village level (N<sub>v</sub>=11)

Average no. of supply in a day	% Villages having skilled manpower for O&M for	% Villages having skilled manpower for O&M for PWS	Community monitoring of water wastage in villages	
2	55%	36%	36%	
% Villages having OHT/ Sump	% Villages having faced O&M challenges	Primary points for reporting grievances	Key problems for reporting grievances	
100%	0%	Other	Other	

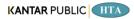


#### 3.9. Perception of HHs on Outcome Indicators

#### a. Health


Incidence of water borne diseases at HH level in last one year as reported

Figure 23: Household reported incidence of water borne diseases in last one year

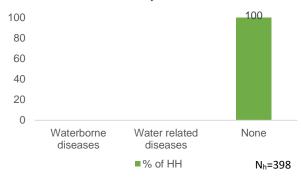



#### b. Economic Income Change in employment days since FHTC programmes/schemes

Figure 24: Household reported a change in employment days since FHTC programmes /schemes

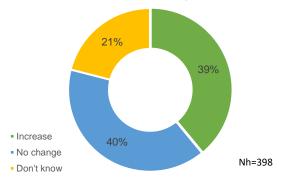

#### c. Drudgery Reduction in time and effort in collecting water

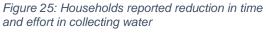

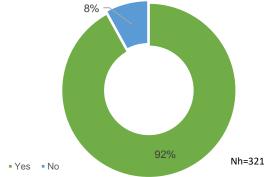



# 3.10. User satisfaction

Table No	Table No. 5:         User satisfaction - more than 75% happy with FHTC services					
S. No.	Parameter (N <sub>h</sub> =398)	In %				
1	Regularity	$\odot$	99			
2	Overall quality	$\odot$	94			
3	Colour	$\odot$	99			
4	Taste		91			
5	Odour	$\bigcirc$	99			

Note:

Base (N<sub>v</sub>)=11 means all villages sampled and covered in Tiruvallur district

Base ( $N_H$ )=398 means all households sampled and covered across the 11 villages in Tiruvallur district Base ( $N_H$ )=398 means all households where female members used to fetch water before HH tap connection



## 4. Annexures

## 4.1. Summary of villages

Table No	b. 6: Village Summary					
S.No.	Name of sample village	Sample HHs	Actual sample HHs (achieved)	No. of scheme	No of source of surface water	No of source of Ground water
#	Total	396	409	13	5	25
1	Arumandai	36	37	2		1
2	Jaganathapuram	36	37	1		1
3	Periyapalayam	36	37	1		5
4	Thirupachur	36	37	1		
5	Ramankoil	36	37	2	3	
6	Thodukadu	36	39	1	2	2
7	Muthukondapuram	36	37	1		3
8	Nemili	36	37	1		1
9	Keechalam	36	37	1		3
10	Senneerkuppam	36	37	1		5
11	Ayappakkam	36	37	1		4

## 4.2. Functionality – 55 LPCD vs regularity vs potability vs working tap connection

Table	Table No. 7: Table No. 1: Functionality of HH tap connection						
S. No.	Village	Functionality* (% HH)	Quantity >=55 LPCD (% HH)	Regularity (% HH)	Potability (% HH)	Working tap connections (%HH)	
#	Total	95	100	100	95	100	
1	Arumandai	97	100	97	100	100	
2	Jaganathapuram	100	100	100	100	100	
3	Periyapalayam	100	100	100	100	100	
4	Thirupachur	100	100	100	100	100	
5	Ramankoil	100	100	100	100	100	
6	Thodukadu	100	100	100	100	100	
7	Muthukondapuram	47	100	100	47	100	
8	Nemili	100	100	100	100	100	
9	Keechalam	97	97	100	100	100	
10	Senneerkuppam	100	100	100	100	100	
11	Ayappakkam	100	100	100	100	100	

\* Fully Functional has been computed as = Adequate Quantity  $\cap$  Fully Regularity Supply  $\cap$  Potable (Quality)



# 4.3. Villages not meeting the quality parameters

S.No.	Block Name	nge- 6.5 to 8.5) Panchayat Name	Villages	No. of HHs outside the acc range	
NA	NA	NA	NA	NA	
		ne (Acceptable Rang		1.0.	
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range	HHs with no chlorine
1		Thodukadu	Thodukadu	38	(
2	Pallipattu	Keechalam	Keechalam	0	30
3	Poonamallee	Senneerkuppam	Senneerkuppam	0	30
4	Sholavaram	Arumandai	Arumandai	1	3
5		Jaganathapuram	Jaganathapuram	24	
6	Thiruvalangadu	Muthukondapuram	Muthukondapuram	0	1
7		Nemili	Nemili	0	3
3. Tu	rbidity (Acceptab	le Range- 1 to 5 NTL	<u>(</u>	r	
S.No.	Block Name	Panchayat Name	Villages	HHs outside the	
		_	_	acceptable/permissible	range
NA	NA	NA	NA	NA	
<u>4. To</u>	tal hardness (Aco	ceptable Range- 200	to 600 Milligram/litre	e)	
S.No.	Block Name	Panchayat Name	Villages	HHs outside the	
0.110.	DIOCK Maille	-		acceptable/permissible rang	е
1	Thiruvalangadu	Muthukondapuram	Muthukondapuram		1
5. To	tal alkalinity (Acc	eptable Range- 200	to 600 Milligram/litre	e)	
S.No.	Block Name	Panchayat Name	Villages	HHs outside the	
5.NO.	DIOCK Maille	Fanchayat Name	villages	acceptable/permissible rang	е
1	Thiruvalangadu	Muthukondapuram	Muthukondapuram		
6. Ch	loride (Acceptab	le Range- 250 to 100	0 Milligram/litre)		
C No	Block Nome	Denehovet Neme	Villageo	HHs outside the	
S.No.	Block Name	Panchayat Name	Villages	acceptable/permissible rang	е
NA	NA	NA	NA	NA	
7. An	nmonia (Acceptal	ble Range- 0.5 Millig	ram/litre)		
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible rang	P
NA	NA	NA	NA	NA	•
		inge- 1 Milligram/litre			
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible rang	•
NA	NA	NA	NA		e
				NA	
<u>9. Nitr</u> S.No.	Block Name	Range- 1 Milligram/lit Panchayat Name	Villages	HHs outside the	
NIA	NA	NA	NA	acceptable/permissible rang	C
NA				NA	
10. Su	ipnate (Acceptab	le Range- 200 to 400	willigram/litre)		
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible rang	е
NA	NA	NA	NA	NA	
<u>11. To</u>	tal dissolved soli	ds (Acceptable Rang	ge- 500 to 2000 Millig		
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible rang	е
NA	NA	NA	NA	NA	
12. Ba	cteriological test	(Presence - Absenc	e Test for Hydrogen	Sulphide producing organism	ns (H2S))
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible rang	
NA	NA	NA	NA	NA	
		e Range- 1 to 1.5 Mi		1	
S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible rang	e
	1		1	accontanto, por missione rang	~
NA	NA	NA	NA	NA	

S.No.	Block Name	Panchayat Name	Villages	HHs outside the acceptable/permissible range
NA	NA	NA	NA	NA

